

General Information

Date & Time: 26, Jan, 2026 12:48

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	57,810
Registration No.	NKO1463	Chassis No.	JTFJT02P4S5039614
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



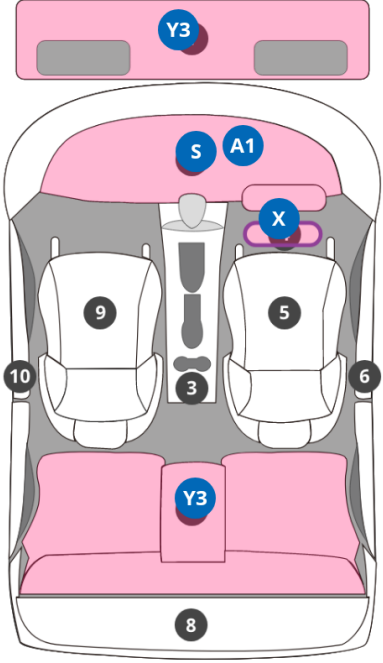
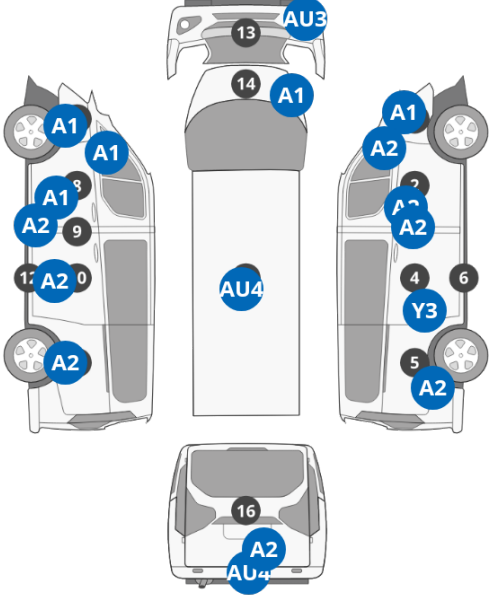
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.9	118	96	140
2	Boot Lid	112.6	108	111	119
3	Roof	163.5	116	121	310/107
4	Left Front Fender	128.6	129	122	135
5	Left Front Door	107.0	125	98	98
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	110.0	113	102	115
9	Right Front Fender	122.0	121	119	126
10	Right Front Door	111.0	112	106	115
11	Center Panel Right	123.3	133	116	121
12	Right Rear Door	110.0	105	111	114
13	Right Back Panel	111.6	119	105	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Rear Seat - Grime - Medium / Mat Other - Missing - Yes / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Medium</p>		<p>Remarks Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Crack, Gap - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Center Panel - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Front Panel - Scratch - Minimal / Roof - Scratch & Dent - Large</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, cracked fog lamps