

General Information

Date & Time: 26, Jan, 2026 10:27

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	70,237
Registration No.	DAT2456	Chassis No.	PA1B18F33L4116493
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



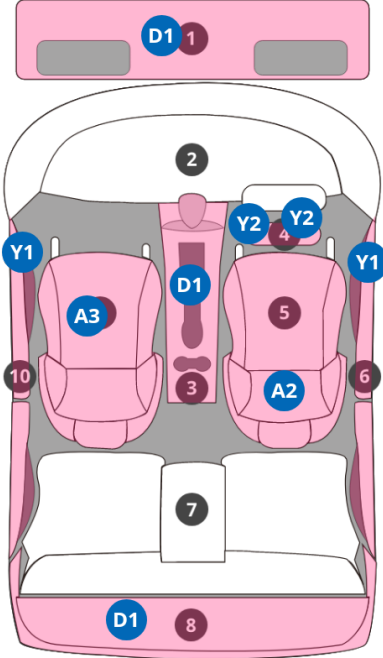
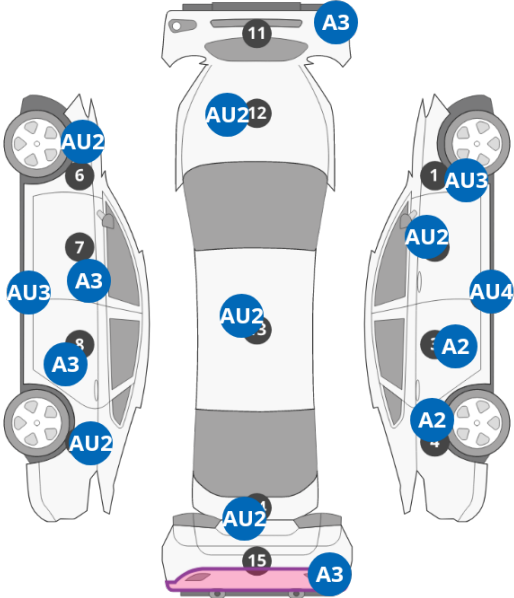
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.0	174	134	181
2	Boot Lid	118.6	117	113	126
3	Roof	101.9	111	97	96/104
4	Left Front Fender	96.3	94	92	103
5	Left Front Door	95.7	98	94	96
6	Center Panel Left				
7	Left Rear Door	104.0	103	111	98
8	Left Back Panel	103.7	107	105	99
9	Right Front Fender	104.3	111	102	100
10	Right Front Door	105.3	107	107	102
11	Center Panel Right				
12	Right Rear Door	105.1	97	101	117
13	Right Back Panel	96.5	91	96	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Cut, Crack - Small / (L) Front Seat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Crinkle - Minimal / (L) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal / Trunk Room - Worked - Minimal / Console, Switchs, Vents - Worked - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with jack, scratches on headlight, issue on taillight right side, with warranty and manual booklet., unusual noise on engine bay, no tools, no reverse camera.