

General Information

Date & Time: 22, Jan, 2026 09:10

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2022 | Odo Meter Reading | 187,288 |
| Registration No. | DAQ6200 | Chassis No. | PA1B18F36N4177789 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Red | | |

Body / Panel Condition



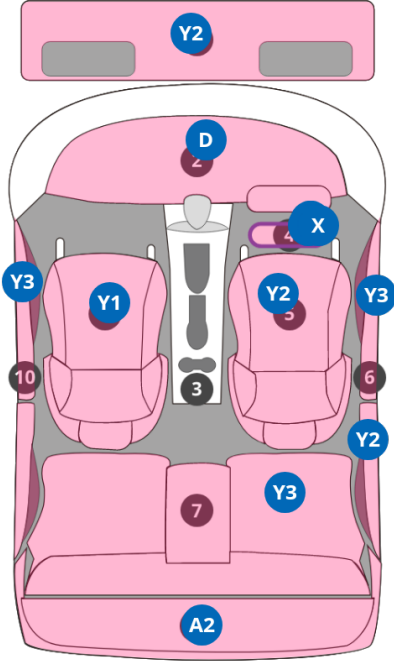
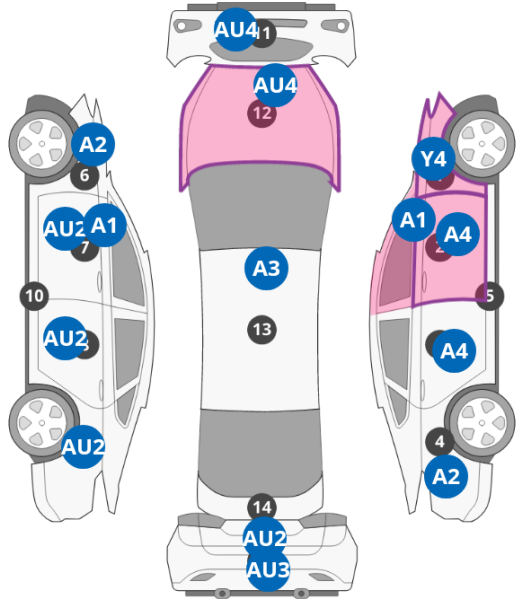
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 122.1 | 163 | 93 | 110 |
| 2 | Boot Lid | 95.4 | 96 | 95 | 96 |
| 3 | Roof | 83.3 | 93 | 84 | 78/79 |
| 4 | Left Front Fender | 92.0 | 91 | 92 | 94 |
| 5 | Left Front Door | 96.1 | 93 | 101 | 94 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 94.9 | 96 | 96 | 94 |
| 8 | Left Back Panel | 98.5 | 110 | 94 | 91 |
| 9 | Right Front Fender | 178.3 | 184 | 154 | 197 |
| 10 | Right Front Door | 841.0 | 176 | 1,109 | 1,238 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 88.3 | 84 | 86 | 95 |
| 13 | Right Back Panel | 91.3 | 85 | 94 | 96 |

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|---|
| Interior Evaluation : C | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p> | <p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Crack, Gap - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch - Medium</p> |
| Frame Evaluation : A | Functional Evaluation : B |
| <p>Remarks Defects not found</p> | <p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p> |

| |
|---|
| <p>Inspector Notes</p> |
| <p>with LTO plate/with spare tire/No spare key/with jack and incomplete tools/reverse camera not working/No warranty booklet/No seat cover/bonnet hood issue/unusual sound engine/trunk room cover missing/shifting knots not original/front and rear mat missing</p> |