

## General Information

Date & Time: 21, Jan, 2026 14:37

<b>Make</b>	Toyota	<b>Model</b>	Raize
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	45,510
<b>Registration No.</b>	DBG1322	<b>Chassis No.</b>	MHKAB1BA6NJ030282
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Red		

## Body / Panel Condition



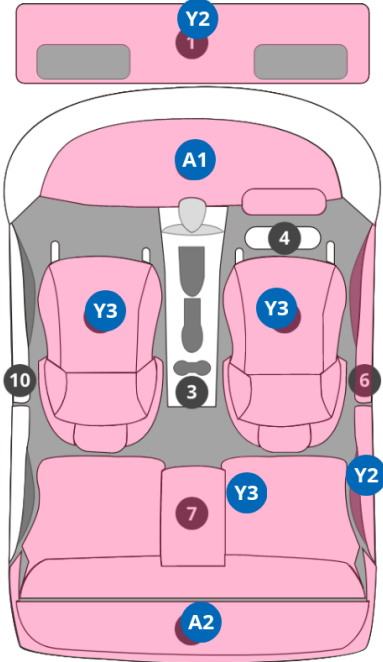
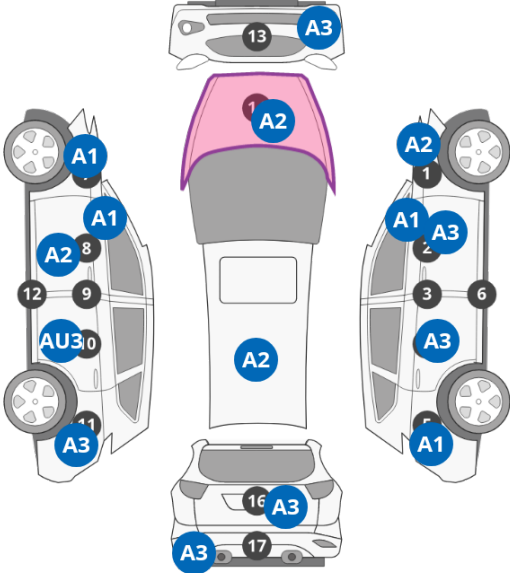
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.1	92	93	86
2	Boot Lid	117.6	130	109	114
3	Roof	118.0	105	91	189/87
4	Left Front Fender	146.0	135	148	155
5	Left Front Door	164.3	178	157	158
6	Center Panel Left				
7	Left Rear Door	174.3	193	153	177
8	Left Back Panel	147.3	176	132	134
9	Right Front Fender	126.3	149	118	112
10	Right Front Door	125.6	142	112	123
11	Center Panel Right				
12	Right Rear Door	141.6	186	123	116
13	Right Back Panel	125.3	112	120	144

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/with reverse camera/with jack No tools/No warranty booklets/No seat cover/bonnet hood faded color/roof faded color/shift shock issue/engine noise vibration/No fog light</p>