

General Information

Date & Time: 22, Jan, 2026 09:57

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	16,165
Registration No.	NFR4332	Chassis No.	MHKB3FE10RK003771
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Cargo
Colour	White		

Body / Panel Condition



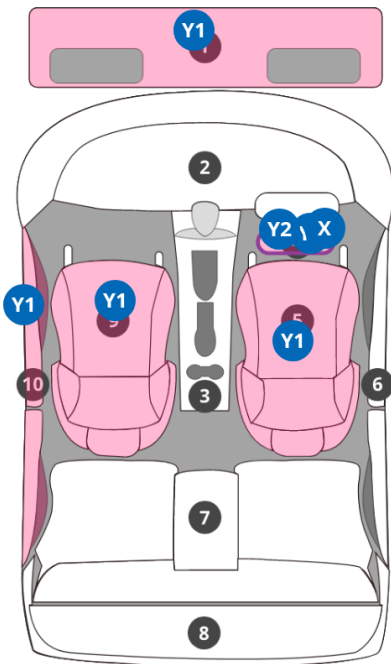
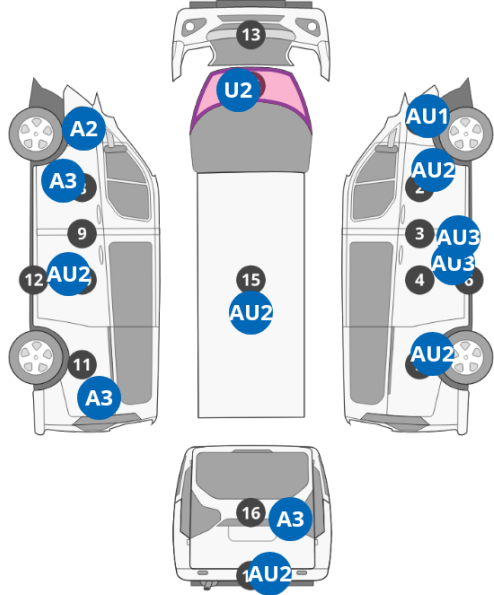
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	66.1	66	76	56
2	Boot Lid	61.6	56	82	47
3	Roof	70.1	87	48	76/70
4	Left Front Fender	58.8	56	55	67
5	Left Front Door	60.7	71	49	63
6	Center Panel Left				
7	Left Rear Door	59.3	63	60	55
8	Left Back Panel	61.5	53	61	70
9	Right Front Fender	59.5	62	51	66
10	Right Front Door	60.8	65	58	60
11	Center Panel Right				
12	Right Rear Door	62.4	63	60	65
13	Right Back Panel	72.5	93	66	59

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Mat Other - Missing - Yes / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal</p>	<p>Remarks (L) Front Door, Molding - Scratch - Medium / Front Panel - Repair mark - Yes / Front Panel - Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with manual booklet, issue on left side taillight, scratches on taillight and headlight.</p>