

General Information

Date & Time: 22, Jan, 2026 07:37

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	13,613
Registration No.	NHM2377	Chassis No.	MHFAA1BY9P0020983
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



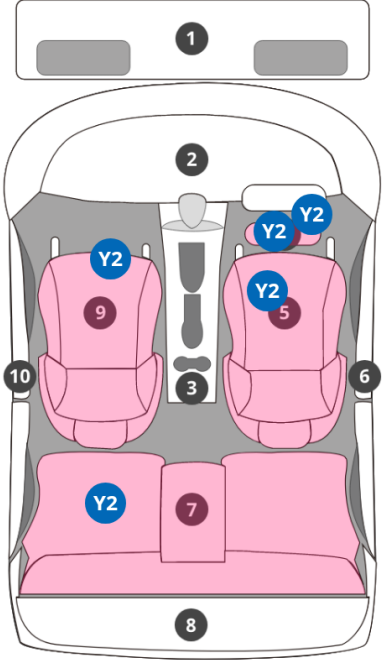
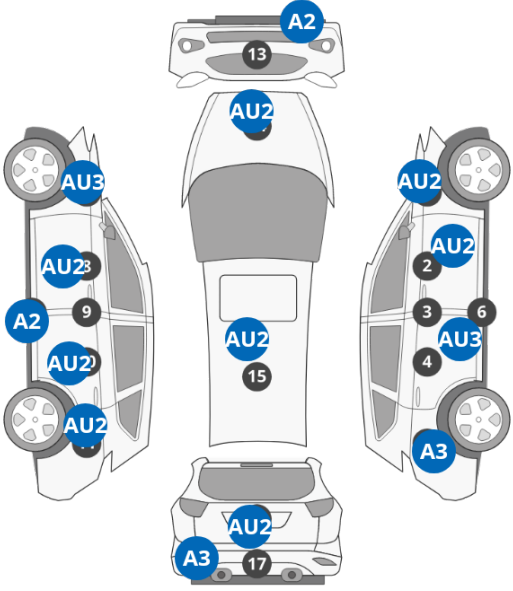
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	102	113	114
2	Boot Lid	115.6	115	110	122
3	Roof	122.5	125	131	121/113
4	Left Front Fender	127.6	160	112	111
5	Left Front Door	117.3	109	117	126
6	Center Panel Left				
7	Left Rear Door	116.6	117	110	123
8	Left Back Panel	130.6	130	128	134
9	Right Front Fender	104.2	112	99	102
10	Right Front Door	116.0	121	113	114
11	Center Panel Right				
12	Right Rear Door	115.6	122	111	114
13	Right Back Panel	120.3	125	119	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Center Panel - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with Manual and warranty booklet, with jack, with reverse camera, scratches on taillight and headlight.</p>