

General Information

Date & Time: 26, Jan, 2026 14:16

Make	Toyota	Model	Rush
YOM	2021	Odo Meter Reading	53,080
Registration No.	NEP6878	Chassis No.	MHKE8FF3PMK032238
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition



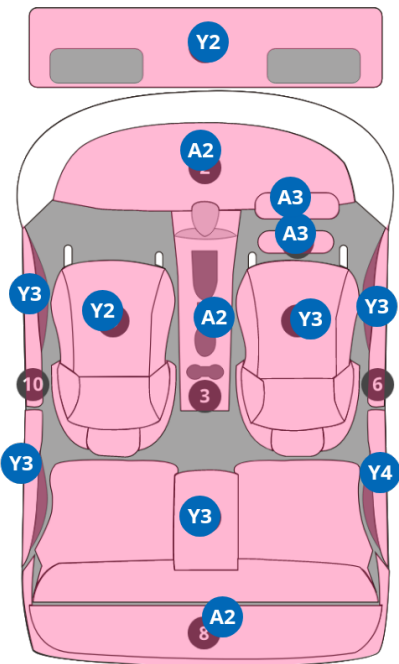
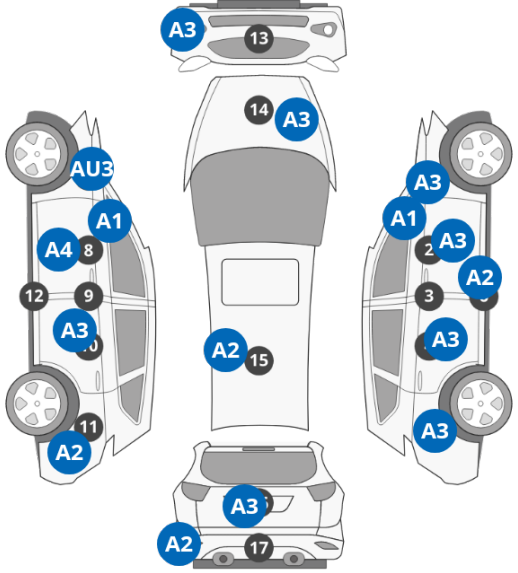
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	115	98	98
2	Boot Lid	91.0	90	89	94
3	Roof	89.5	83	75	97/103
4	Left Front Fender	101.9	100	107	99
5	Left Front Door	100.7	99	100	103
6	Center Panel Left				
7	Left Rear Door	106.8	112	110	98
8	Left Back Panel	105.3	102	107	107
9	Right Front Fender	128.6	138	131	117
10	Right Front Door	117.0	120	107	124
11	Center Panel Right				
12	Right Rear Door	111.6	101	103	131
13	Right Back Panel	143.3	150	143	137

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Large / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No LTO plate/with spare tire/No spare key/with warranty booklet/with reverse camera/with jack and incomplete tools/No seat cover/interior dirty/shift shock</p>