

General Information

Date & Time: 23, Jan, 2025 17:01

Make	Toyota	Model	Vios
YOM	2022	Mileage	69,193
Registration No.	DAQ9208	Chassis No.	PA1B18F30N4179487
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



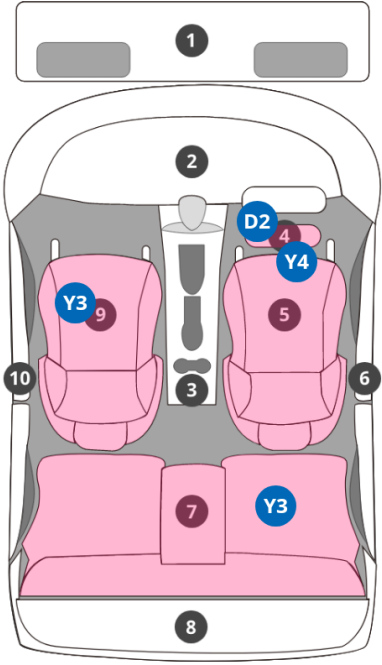
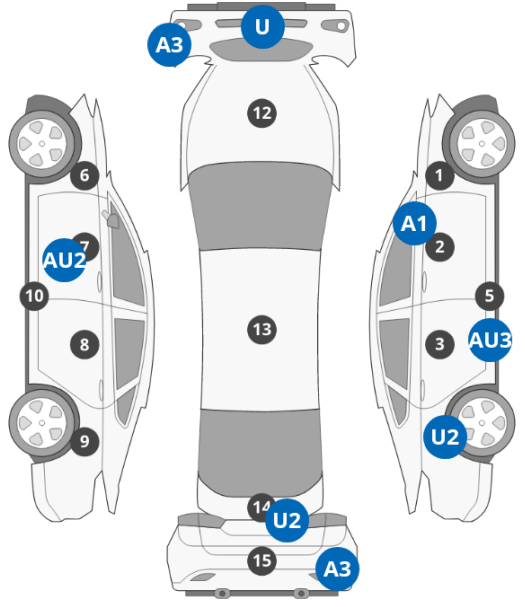
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	174.3	172	172	179
2	Boot Lid	158.0	160	151	163
3	Roof	141.0	143	133	125/163
4	Left Front Fender	158.0	149	166	159
5	Left Front Door	146.6	150	144	146
6	Center Panel Left				
7	Left Rear Door	157.0	170	148	153
8	Left Back Panel	197.3	182	246	164
9	Right Front Fender	156.3	161	155	153
10	Right Front Door	226.6	295	184	201
11	Center Panel Right				
12	Right Rear Door	219.0	190	201	266
13	Right Back Panel	178.6	166	138	232

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Rear Fender, Molding - Dent - Small / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no tools/ no warranty booklet/ no jack/ with spare tire/ with LTO plate