

General Information

Date & Time: 23, Jan, 2026 10:20

Make	Toyota	Model	Innova
YOM	2007	Odo Meter Reading	192,838
Registration No.	ZLT704	Chassis No.	TGN405011117
CC	2.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



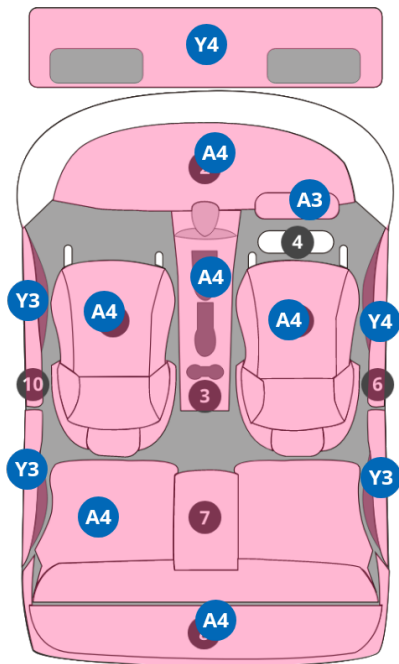
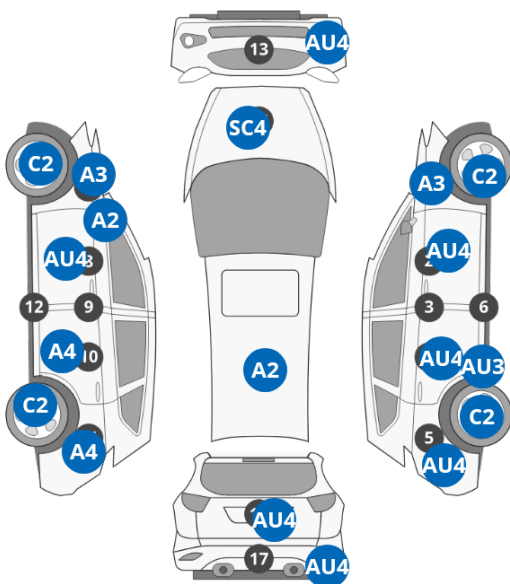
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.2	95	93	92
2	Boot Lid	111.0	100	119	114
3	Roof	78.5	67	88	75/85
4	Left Front Fender	244.0	511	106	115
5	Left Front Door	218.3	161	152	342
6	Center Panel Left				
7	Left Rear Door	162.6	184	149	155
8	Left Back Panel	139.0	154	133	130
9	Right Front Fender	517.3	188	155	1,209
10	Right Front Door	143.6	153	134	144
11	Center Panel Right				
12	Right Rear Door	131.6	130	137	128
13	Right Back Panel	119.6	108	118	133

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Cut, Crack - Large / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / Rear Seat - Cut, Crack - Large / Trunk Room - Worn, Scratch, Cut, Crack - Large / (R) Front Trim - Grime - Large / (R) Rear Trim - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Large / (R) Front Seat - Cut, Crack - Large / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Large / Ceiling - Grime - Large</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Rust, Corrosion - Large / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Roof - Scratch - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 1 spare key/reverse not working/No jack and tools/No warranty booklets/glove box issue/headlight cover issue/tail light cover issue/all around vehicle faded color/engine noise/vibration/interior dirty/power window issue/audio radio issue/wiper issue/possible flooding/dashboard box cover missing/</p>