

General Information

Date & Time: 27, Jan, 2026 20:03

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	54,680
Registration No.	FAO7132	Chassis No.	MHFAA1BY4P0015576
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



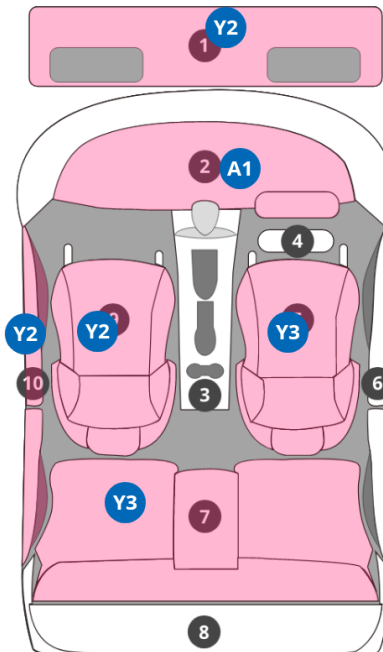
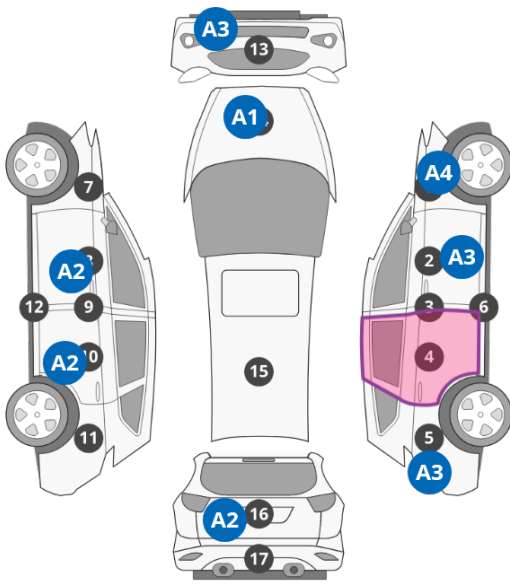
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.8	105	92	103
2	Boot Lid	129.3	111	167	110
3	Roof	109.7	106	125	100/108
4	Left Front Fender	91.5	90	94	91
5	Left Front Door	101.6	98	101	106
6	Center Panel Left				
7	Left Rear Door	111.6	109	104	122
8	Left Back Panel	107.0	113	99	109
9	Right Front Fender	103.7	89	105	117
10	Right Front Door	99.6	100	97	102
11	Center Panel Right				
12	Right Rear Door	110.6	119	109	104
13	Right Back Panel	114.3	112	100	131

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Ceiling - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With LTO plate/ No spare tire/with 1 spare key/ right front panel faded color/</p>