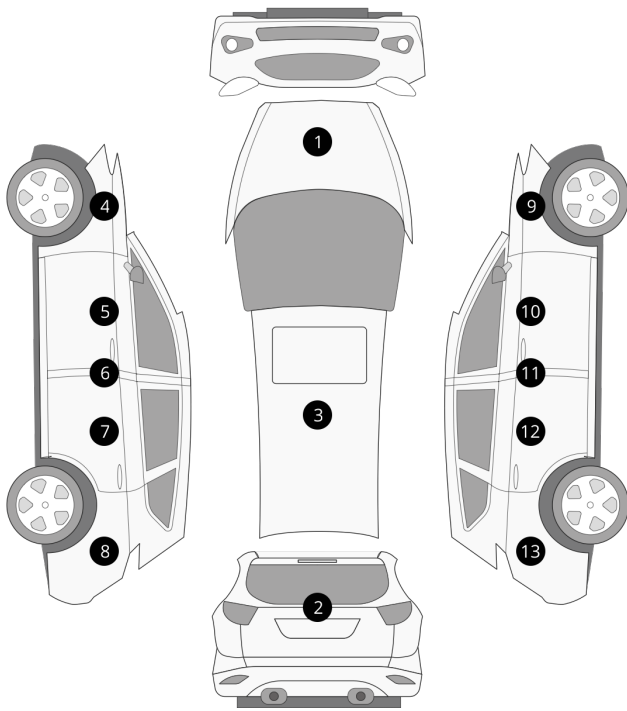


General Information

Date & Time: 26, Jan, 2026 13:52

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	31,275
Registration No.	GBE9804	Chassis No.	PA1B18F39R4268559
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



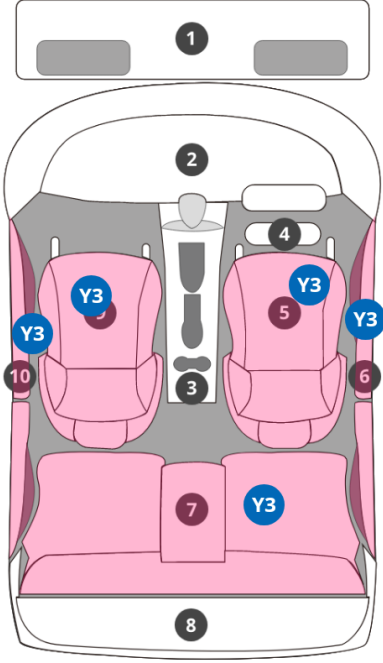
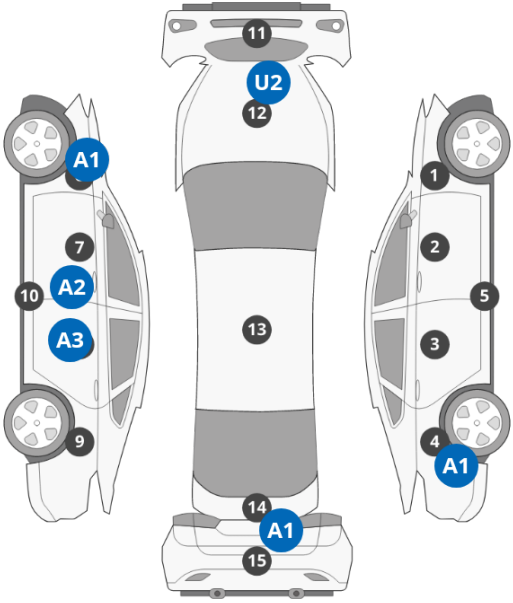
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	119	97	111
2	Boot Lid	124.0	117	114	141
3	Roof	90.2	96	89	86/90
4	Left Front Fender	86.6	89	85	87
5	Left Front Door	92.9	88	91	100
6	Center Panel Left				
7	Left Rear Door	98.0	109	91	95
8	Left Back Panel	126.1	187	101	90
9	Right Front Fender	93.0	93	90	96
10	Right Front Door	96.7	107	90	93
11	Center Panel Right				
12	Right Rear Door	93.8	87	94	101
13	Right Back Panel	99.5	103	95	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Bonnet, Headlight - Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate/with spare tire/with reverse camera/No jack and tools/No warranty booklet/with seat cover</p>