

General Information

Date & Time: 23, Jan, 2026 11:33

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	13,592
Registration No.	DBM3667	Chassis No.	MR0AB8DD5R5150889
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



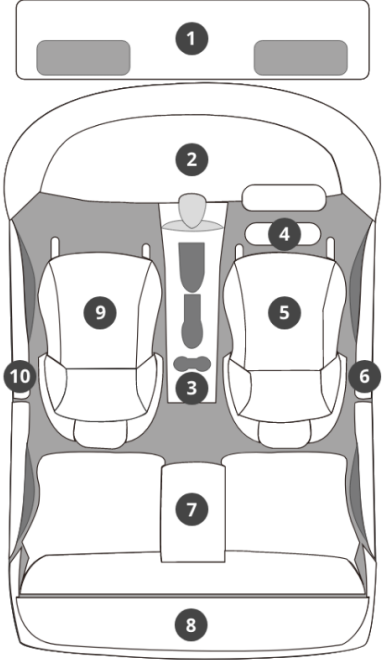
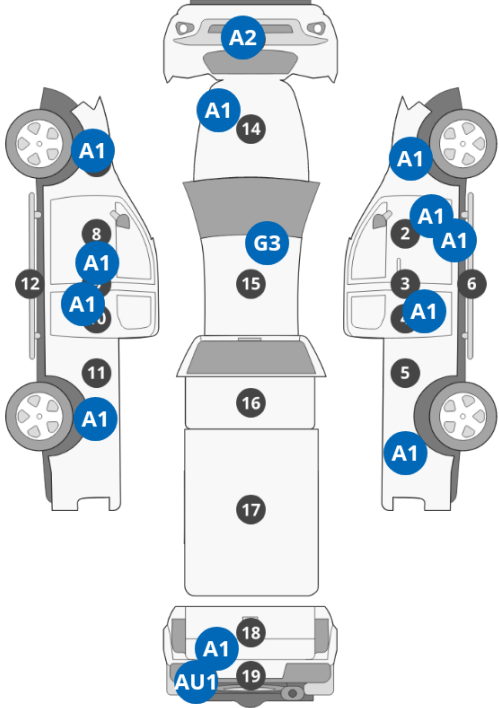
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.5	116	99	105
2	Boot Lid	85.9	86	84	87
3	Roof	112.3	110	89	126/124
4	Left Front Fender	105.1	127	100	89
5	Left Front Door	91.5	90	95	90
6	Center Panel Left				
7	Left Rear Door	89.5	88	96	85
8	Left Back Panel	101.3	102	102	100
9	Right Front Fender	96.6	91	95	104
10	Right Front Door	93.3	87	95	98
11	Center Panel Right				
12	Right Rear Door	87.3	85	82	95
13	Right Back Panel	97.4	93	100	99

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks Front Windshield - Scratch, Stone chip - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, 4keys, no tools, scratches on headlights,