

General Information

Date & Time: 20, Jan, 2026 19:16

Make	Nissan	Model	Navara
YOM	2022	Odo Meter Reading	41,763
Registration No.	NGY4539	Chassis No.	MNTCCAD23Z0006596
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



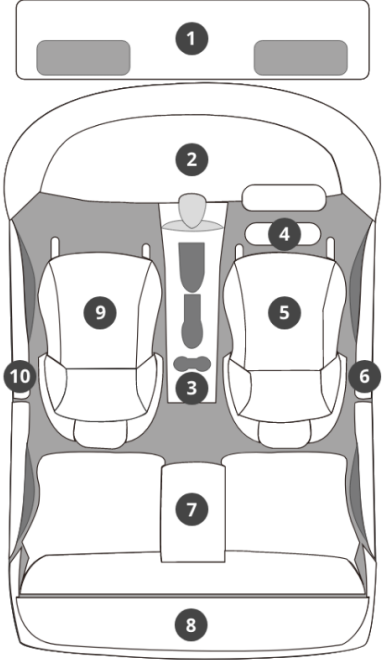
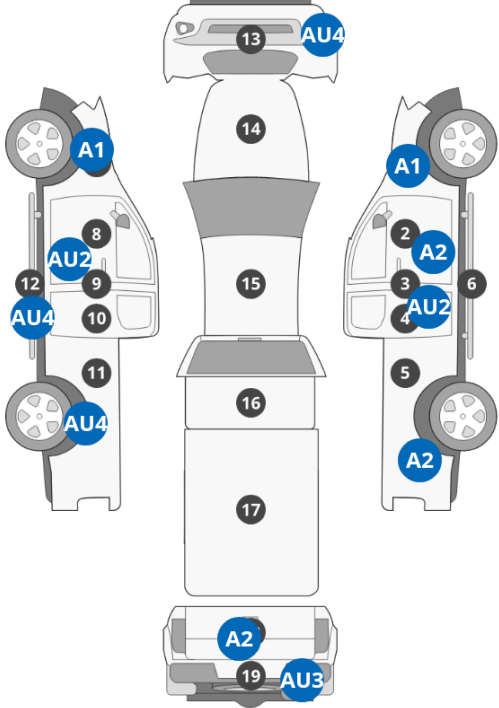
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	127	107	107
2	Boot Lid	116.3	125	109	115
3	Roof	87.3	84	79	91/96
4	Left Front Fender	109.3	116	108	104
5	Left Front Door	98.1	102	99	94
6	Center Panel Left				
7	Left Rear Door	98.6	95	100	101
8	Left Back Panel	107.6	100	108	115
9	Right Front Fender	107.6	103	109	111
10	Right Front Door	103.9	98	107	107
11	Center Panel Right				
12	Right Rear Door	104.3	103	109	101
13	Right Back Panel	97.7	104	91	99

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (L) Front Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Small / Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet and LTO plate/ with spare tire and jack / no tools/ rear latch locked(no key)