

General Information

Date & Time: 21, Jan, 2026 15:58

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,968
Registration No.	DBU7240	Chassis No.	PA1B18F32R4277992
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



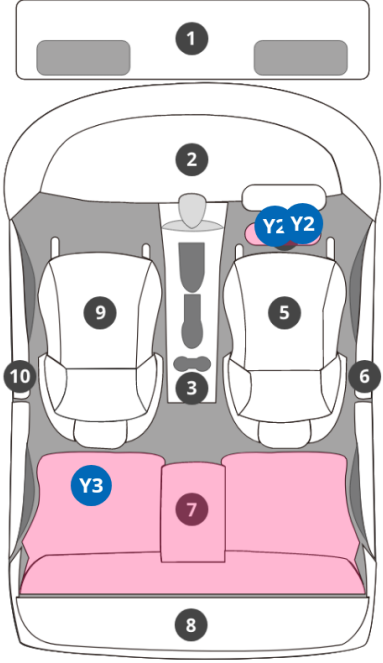
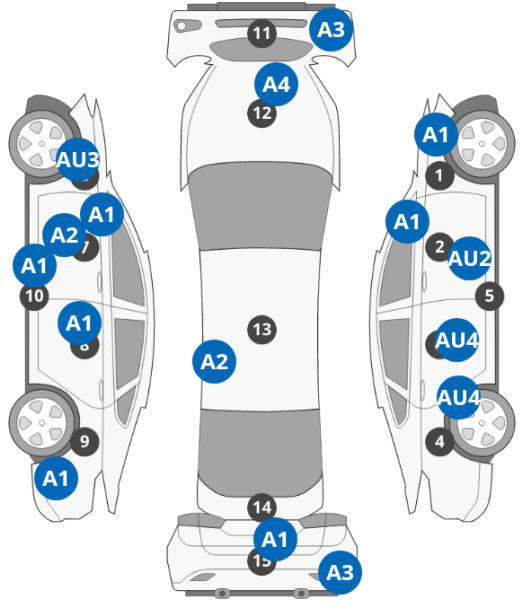
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	119	112	107
2	Boot Lid	119.6	124	115	120
3	Roof	107.4	107	115	99/109
4	Left Front Fender	111.3	114	113	107
5	Left Front Door	196.3	192	174	223
6	Center Panel Left				
7	Left Rear Door	184.0	205	176	171
8	Left Back Panel	115.3	121	108	117
9	Right Front Fender	115.0	117	115	113
10	Right Front Door	103.5	109	99	103
11	Center Panel Right				
12	Right Rear Door	114.3	108	113	122
13	Right Back Panel	123.0	125	121	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No Lto plate, no warranty booklet, no spare tire, no jack and tools, scratches on headlights and taillights</p>