

## General Information

Date & Time: 23, Jan, 2026 17:20

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	39,862
<b>Registration No.</b>	CCG3983	<b>Chassis No.</b>	PA1B18F30R4268885
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



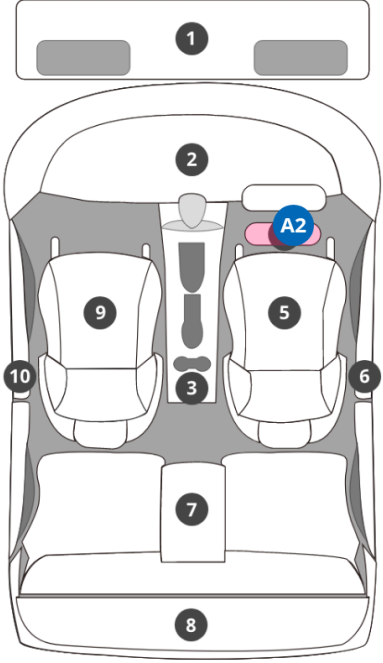
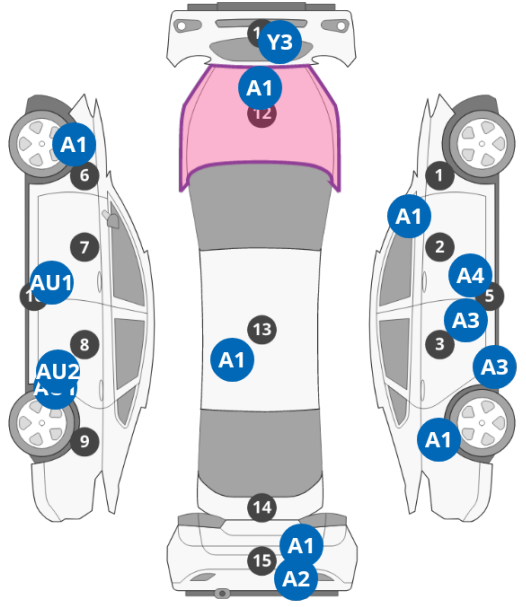
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	132.3	138	129	130
2	Boot Lid	109.6	109	104	116
3	Roof	96.9	103	94	95/96
4	Left Front Fender	95.0	95	90	99
5	Left Front Door	103.6	101	104	106
6	Center Panel Left				
7	Left Rear Door	105.0	111	104	100
8	Left Back Panel	113.0	123	110	106
9	Right Front Fender	103.6	106	103	102
10	Right Front Door	95.4	99	92	95
11	Center Panel Right				
12	Right Rear Door	99.9	106	97	97
13	Right Back Panel	103.9	101	100	111

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Cut, Crack - Small</p>	<p><b>Remarks</b> (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with jack and tools, 1key, no warranty booklet and spare tire, scratches on headlights, scratches on F windshield, battery weak</p>