

General Information

Date & Time: 23, Jan, 2026 11:36

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	17,356
Registration No.	CAZ9634	Chassis No.	PA1B18F35R4241018
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



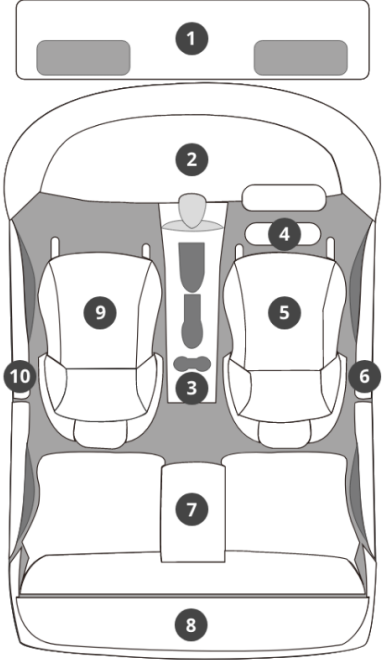
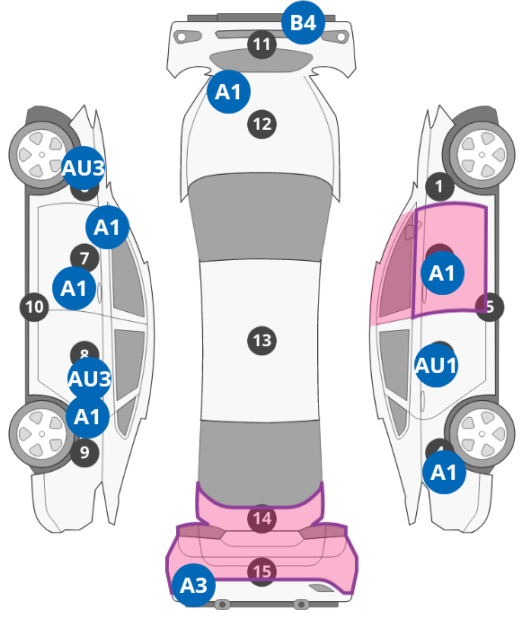
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	108	102	101
2	Boot Lid	107.0	104	100	117
3	Roof	91.4	100	88	87/91
4	Left Front Fender	95.9	98	90	99
5	Left Front Door	100.4	100	105	96
6	Center Panel Left				
7	Left Rear Door	104.0	105	106	101
8	Left Back Panel	108.6	123	98	105
9	Right Front Fender	97.0	99	99	94
10	Right Front Door	117.6	113	120	120
11	Center Panel Right				
12	Right Rear Door	93.2	90	90	99
13	Right Back Panel	99.8	97	94	108

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Modified - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, bumper logo missing