

General Information

Date & Time: 21, Jan, 2026 13:45

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,455
Registration No.	NJC2302	Chassis No.	PA1B18F39S4286713
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



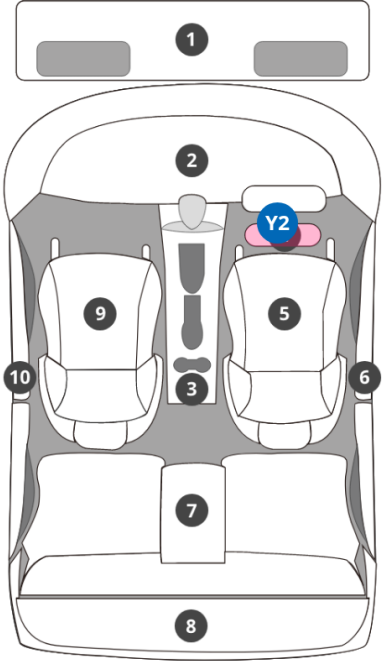
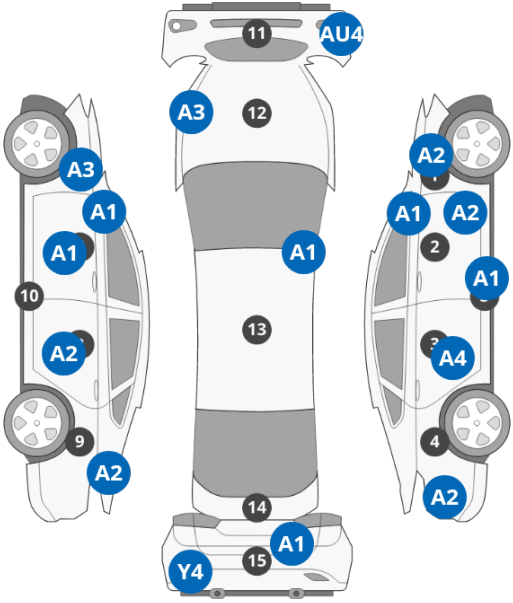
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	121	107	111
2	Boot Lid	116.3	112	119	118
3	Roof	103.4	112	106	97/99
4	Left Front Fender	100.1	100	100	101
5	Left Front Door	103.3	103	103	104
6	Center Panel Left				
7	Left Rear Door	109.6	105	103	121
8	Left Back Panel	107.6	115	103	105
9	Right Front Fender	109.6	112	107	110
10	Right Front Door	108.6	109	108	109
11	Center Panel Right				
12	Right Rear Door	109.6	113	107	109
13	Right Back Panel	112.3	111	109	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire, 2keys, no tools and Jack ,scratches on headlights and taillights</p>