

General Information

Date & Time: 26, Jan, 2026 19:51

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	23,244
Registration No.	FAO4701	Chassis No.	PA1B18F32P4203999
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



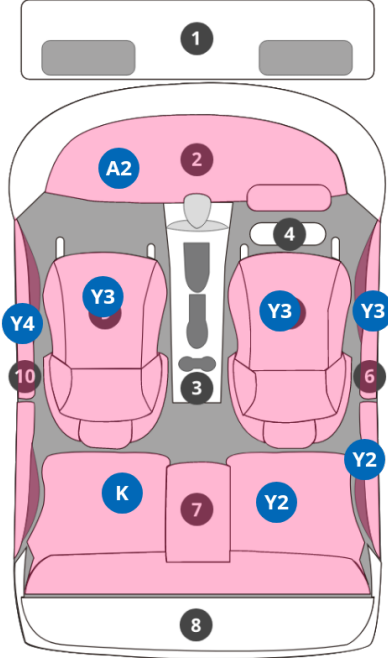
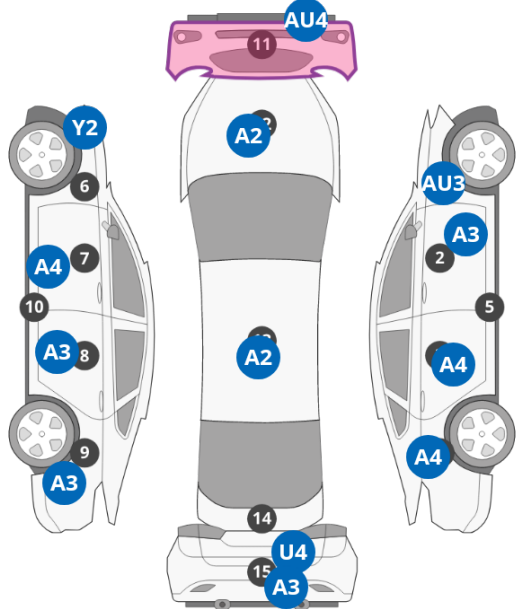
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.6	107	84	102
2	Boot Lid	97.3	101	93	98
3	Roof	92.3	93	93	91/92
4	Left Front Fender	89.5	88	93	88
5	Left Front Door	90.8	83	102	88
6	Center Panel Left				
7	Left Rear Door	91.4	88	93	93
8	Left Back Panel	92.9	97	91	91
9	Right Front Fender	102.2	91	125	90
10	Right Front Door	130.0	93	153	144
11	Center Panel Right				
12	Right Rear Door	126.6	91	150	139
13	Right Back Panel	93.0	91	94	94

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Overall Interior - Animal Hair - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Crack, Gap - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / (R) Front Door, Molding - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate/No Warranty Booklet/with jack and tools/with seat cover/No spare key/ No reverse Camera</p>