

General Information

Date & Time: 23, Jan, 2026 09:41

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	58,573
Registration No.	NFK5406	Chassis No.	PA1B18F39N4175163
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



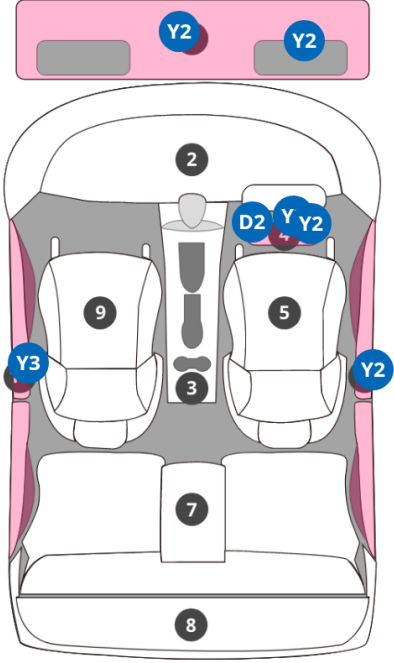
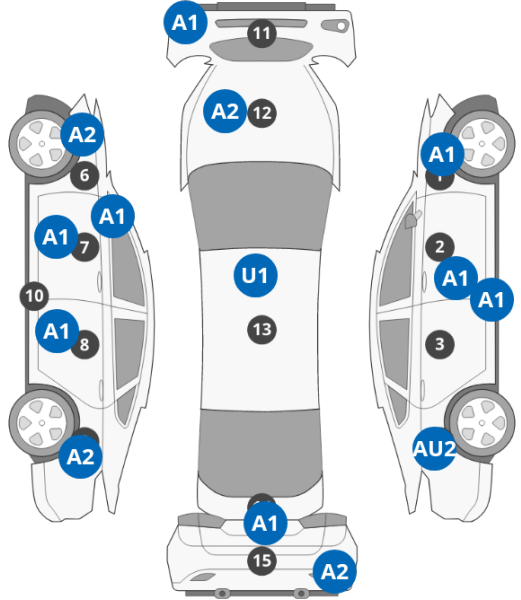
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	111	109	108
2	Boot Lid	109.6	104	112	113
3	Roof	103.2	115	102	95/101
4	Left Front Fender	96.5	104	94	92
5	Left Front Door	107.6	106	114	103
6	Center Panel Left				
7	Left Rear Door	125.6	129	123	125
8	Left Back Panel	108.6	117	105	104
9	Right Front Fender	153.6	139	145	177
10	Right Front Door	103.3	108	102	100
11	Center Panel Right				
12	Right Rear Door	97.6	92	94	107
13	Right Back Panel	139.0	142	142	133

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	B
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small</p>		<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Dent - Minimal</p>	
Frame Evaluation :	B	Functional Evaluation :	B
<p>Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
Without warranty booklet. Incomplete tools. With spare tire, jack and seat cover. 1 key. With LTO plate.