

General Information

Date & Time: 06, Feb, 2026 12:22

Make	Toyota	Model	Raize
YOM	2025	Odo Meter Reading	16,418
Registration No.	DBT4195	Chassis No.	MHKAB1BA1SJ117115
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



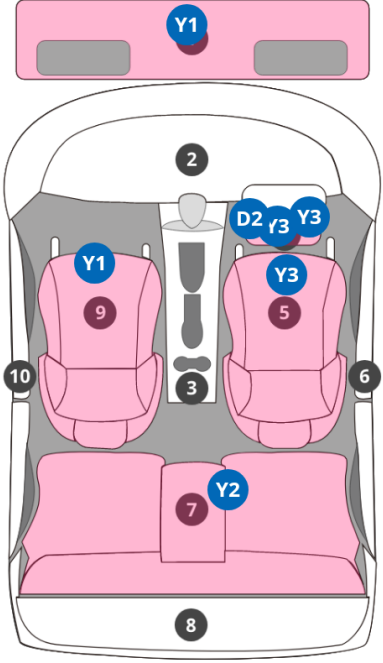
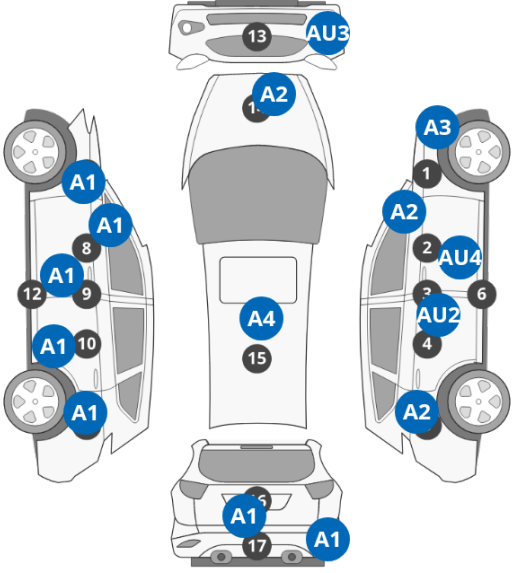
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	99	117	95
2	Boot Lid	83.6	80	91	80
3	Roof	108.5	120	127	88/100
4	Left Front Fender	98.3	96	106	93
5	Left Front Door	104.0	105	106	101
6	Center Panel Left				
7	Left Rear Door	101.7	108	103	94
8	Left Back Panel	86.8	84	86	91
9	Right Front Fender	87.2	78	97	87
10	Right Front Door	99.2	100	105	93
11	Center Panel Right				
12	Right Rear Door	92.4	89	89	99
13	Right Back Panel	79.5	76	84	79

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratches on tail light,</p>