

General Information

Date & Time: 26, Jan, 2026 12:42

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	25,806
Registration No.	DBQ5050	Chassis No.	MR0AB8DD9R5038788
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



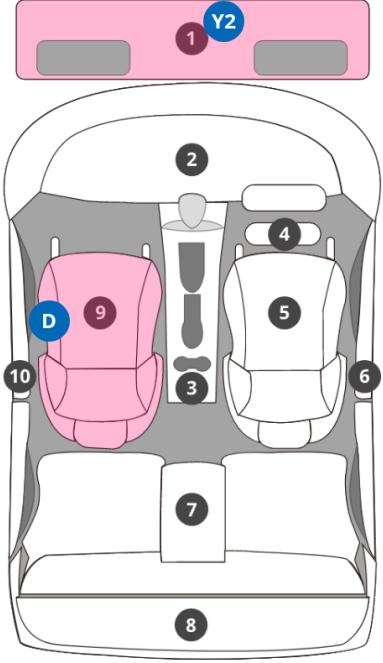
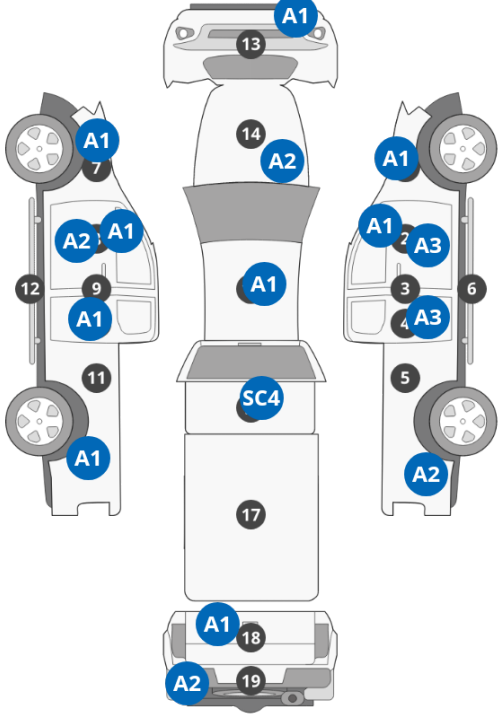
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	122	130	130
2	Boot Lid	92.5	88	91	98
3	Roof	117.0	122	118	112/116
4	Left Front Fender	115.3	110	126	110
5	Left Front Door	106.8	114	107	99
6	Center Panel Left				
7	Left Rear Door	104.9	113	106	96
8	Left Back Panel	115.6	127	112	108
9	Right Front Fender	122.3	114	119	134
10	Right Front Door	104.3	107	105	101
11	Center Panel Right				
12	Right Rear Door	104.6	104	102	108
13	Right Back Panel	109.3	116	111	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Worn - Yes / Ceiling - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / Cab Back Panel - Rust, Corrosion - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with warranty booklet, jack and tools, with spare tire and LTO PLATE, scratched and cracked tail light