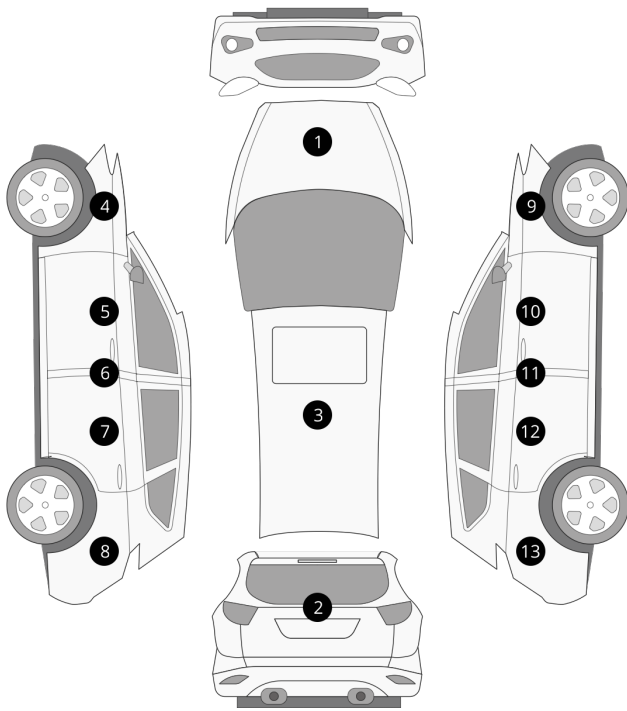


General Information

Date & Time: 27, Jan, 2026 08:53

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	49,113
Registration No.	NKO8849	Chassis No.	PAHACACA8S6423677
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



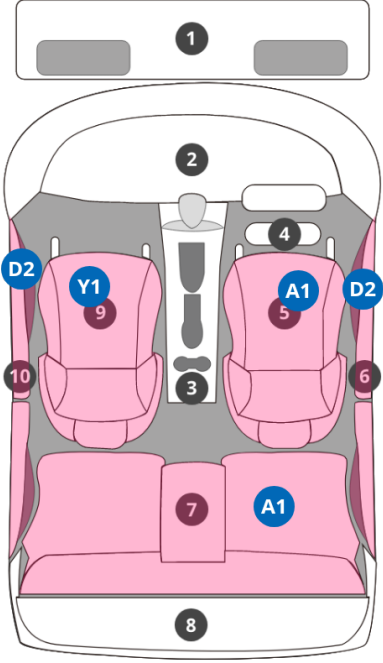
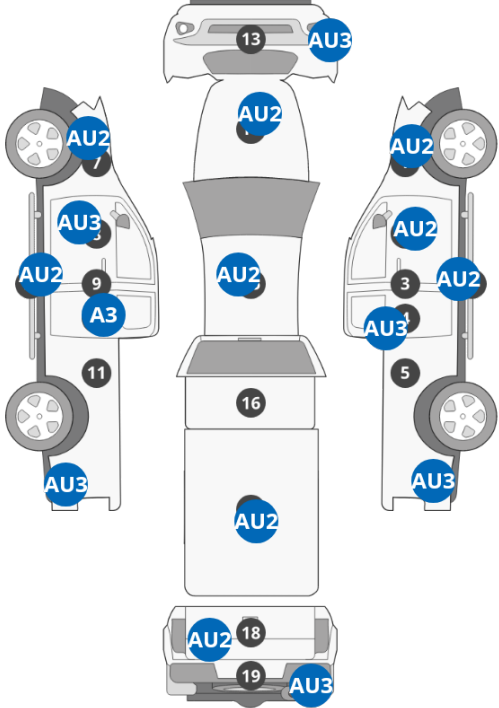
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.0	90	87	115
2	Boot Lid	48.8	54	43	49
3	Roof	121.5	139	131	115/101
4	Left Front Fender	105.7	112	112	93
5	Left Front Door	97.7	100	101	92
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	67.5	68	74	61
9	Right Front Fender	105.2	99	102	115
10	Right Front Door	96.4	97	98	95
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	83.6	81	86	84

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Cut, Crack - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Rear Seat - Cut, Crack - Minimal</p>		<p>Remarks (L) Rear Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Side Gate - Scratch & Dent - Medium / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Cargo Bed Floor - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>	

Inspector Notes
with LTO plate, with spare tire, with jack, with manual and warranty booklet, with spare key, no reverse camera, no tools, scratches on taillight and headlight, issue in headunit.