

General Information

Date & Time: 02, Feb, 2026 09:46

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	21,903
Registration No.	NKH2665	Chassis No.	PA1B18F36R4271158
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



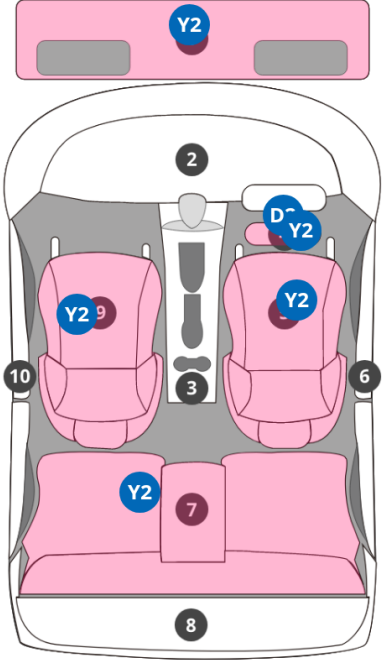
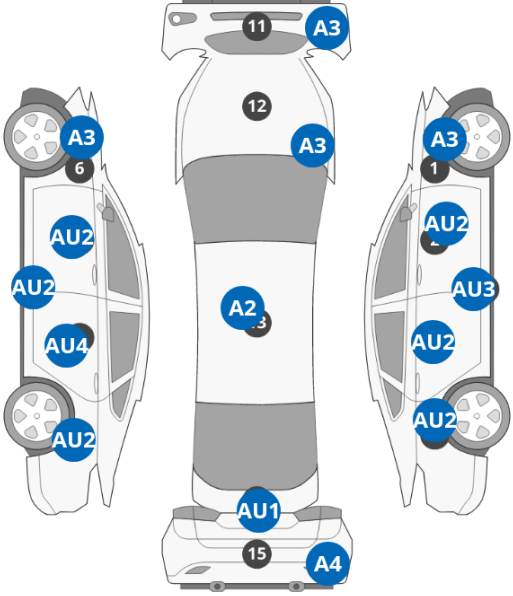
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	130	113	127
2	Boot Lid	127.0	124	121	136
3	Roof	113.7	110	109	112/124
4	Left Front Fender	109.0	111	103	113
5	Left Front Door	113.0	111	109	119
6	Center Panel Left				
7	Left Rear Door	117.0	130	111	110
8	Left Back Panel	115.3	125	117	104
9	Right Front Fender	108.3	110	112	103
10	Right Front Door	114.3	123	106	114
11	Center Panel Right				
12	Right Rear Door	108.6	110	106	110
13	Right Back Panel	124.3	144	112	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks Roof - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with spare key, with jack, with manual and warranty booklet, with reverse camera, scratches on taillight and headlight.</p>