

General Information

Date & Time: 26, Jan, 2026 16:06

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,973
Registration No.	NKG1335	Chassis No.	PA1B18F37R4274165
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



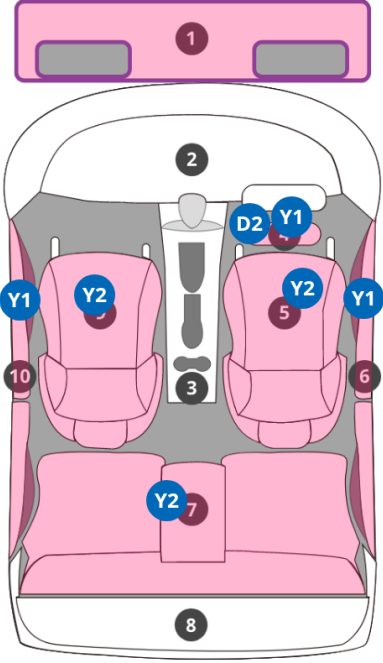
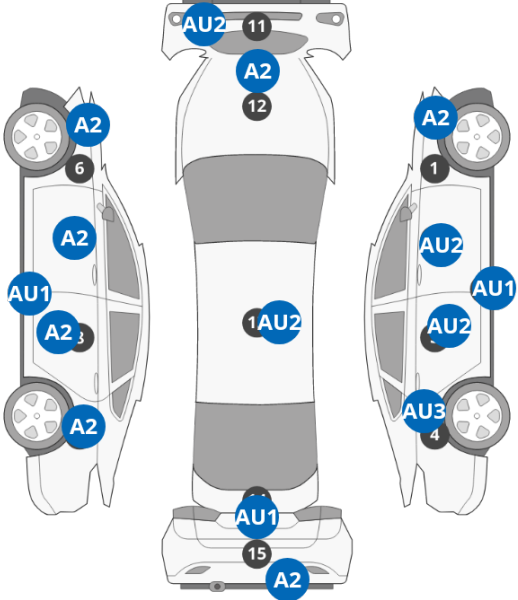
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.3	174	102	127
2	Boot Lid	114.0	123	102	117
3	Roof	100.4	98	98	108/97
4	Left Front Fender	98.0	94	101	99
5	Left Front Door	99.8	95	107	98
6	Center Panel Left				
7	Left Rear Door	93.7	86	95	101
8	Left Back Panel	109.0	121	103	103
9	Right Front Fender	103.2	109	100	101
10	Right Front Door	101.8	98	103	105
11	Center Panel Right				
12	Right Rear Door	109.6	101	101	127
13	Right Back Panel	99.8	93	100	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Room Lamp - Missing - Yes / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Crinkle - Small / (R) Front Floor Mat - Grime - Minimal</p>	<p>Remarks Bonnet - Repair Traces - Yes / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with incomplete tools and jack, with reverse camera, with manual and warranty booklet, scratches on taillight and headlight, no spare key.</p>