

General Information

Date & Time: 26, Jan, 2026 18:25

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	32,982
Registration No.	NKE1509	Chassis No.	PA1B18F3XR4257537
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



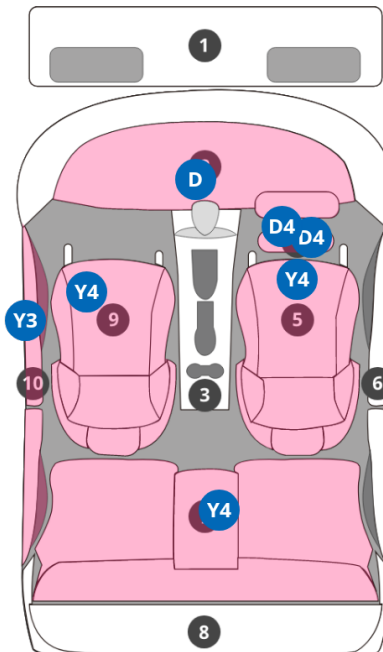
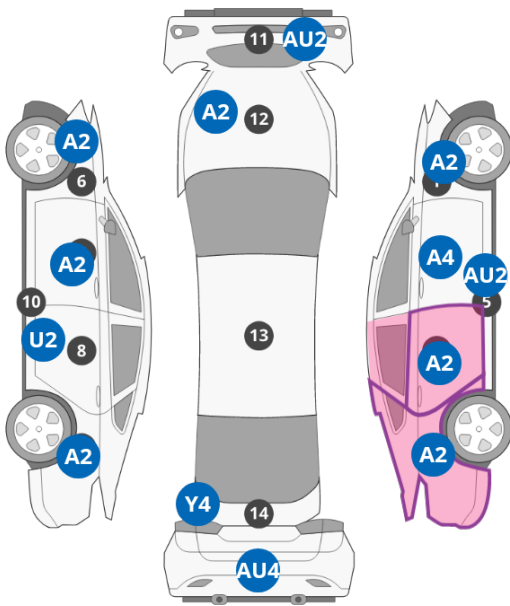
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	114	110	112
2	Boot Lid	106.3	105	104	110
3	Roof	101.9	103	97	98/109
4	Left Front Fender	121.6	131	127	107
5	Left Front Door	118.0	123	116	115
6	Center Panel Left				
7	Left Rear Door	102.8	100	101	108
8	Left Back Panel	110.6	122	109	101
9	Right Front Fender	138.0	142	137	135
10	Right Front Door	89.0	98	84	85
11	Center Panel Right				
12	Right Rear Door	193.0	242	164	173
13	Right Back Panel	168.6	129	135	242

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (R) Front Floor Mat - Worked - Large / (L) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Large / Trunk Hood, Rear Gate - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no jack and tools/ no warranty booklet/ with spare tire and LTO plate/</p>