

General Information

Date & Time: 26, Jan, 2026 08:09

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	10,400
Registration No.	GBD8785	Chassis No.	MHKAA1BC0RJ026335
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



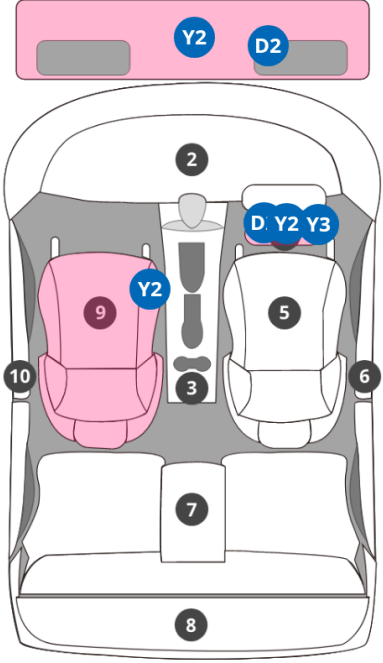
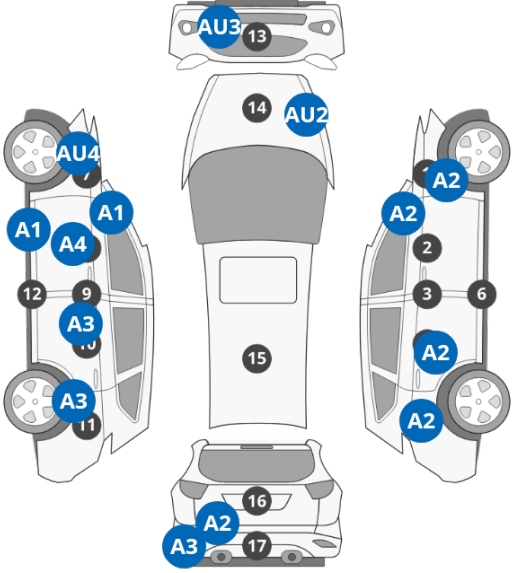
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	122	120	113
2	Boot Lid	80.9	82	89	72
3	Roof	80.3	86	74	81/81
4	Left Front Fender	92.6	91	94	94
5	Left Front Door	104.6	93	105	116
6	Center Panel Left				
7	Left Rear Door	97.9	108	97	89
8	Left Back Panel	91.1	92	90	92
9	Right Front Fender	85.7	93	86	78
10	Right Front Door	105.7	123	101	93
11	Center Panel Right				
12	Right Rear Door	103.4	92	98	121
13	Right Back Panel	92.2	91	90	96

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / Sunvisor, Sunglass Holder - Crinkle - Small / Ceiling - Grime - Small / Mat Other - Grime - Small / (R) Front Floor Mat - Grime - Medium</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Gap at front bumper. With warranty booklet, spare tire and jack. Incomplete seat cover. Without tools. 1 key. With LTO plate.</p>