

General Information

Date & Time: 26, Jan, 2026 12:40

Make	Toyota	Model	Raize
YOM	2025	Odo Meter Reading	1,640
Registration No.	NJC5269	Chassis No.	MHKAB1BA9SJ116181
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



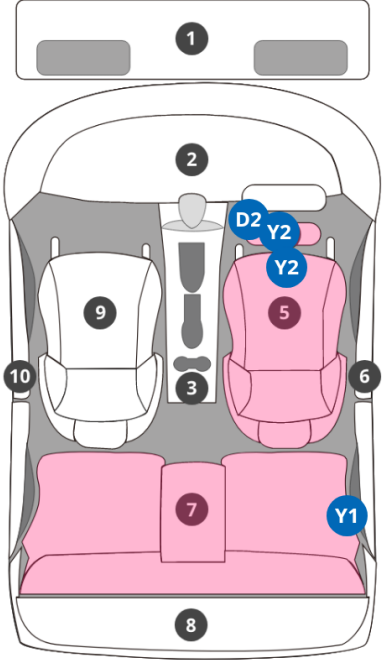
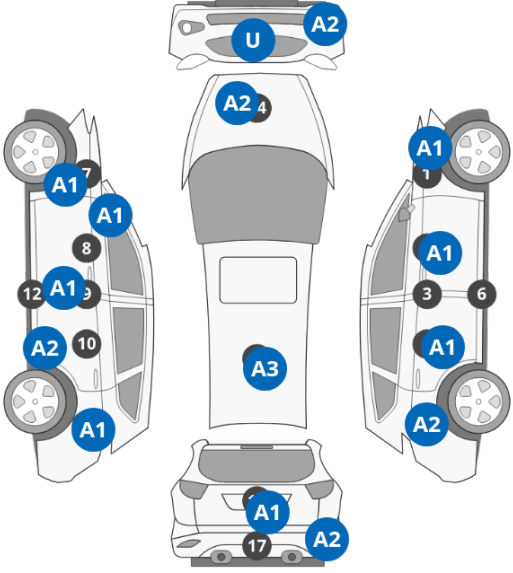
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	103	115	120
2	Boot Lid	87.3	86	91	85
3	Roof	104.2	111	124	84/98
4	Left Front Fender	96.1	98	95	95
5	Left Front Door	104.6	103	107	104
6	Center Panel Left				
7	Left Rear Door	104.1	110	106	97
8	Left Back Panel	87.0	85	89	88
9	Right Front Fender	88.5	78	100	88
10	Right Front Door	95.3	89	100	97
11	Center Panel Right				
12	Right Rear Door	94.1	96	92	94
13	Right Back Panel	85.8	83	88	87

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Minimal</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light</p>