

General Information

Date & Time: 26, Jan, 2026 19:12

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	20,321
Registration No.	NHS3541	Chassis No.	PA1B18F33R4261221
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



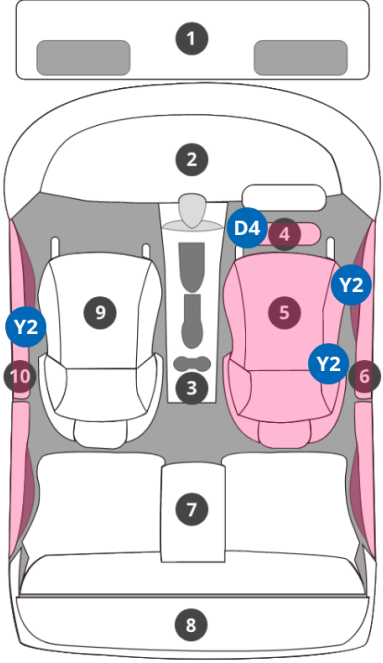
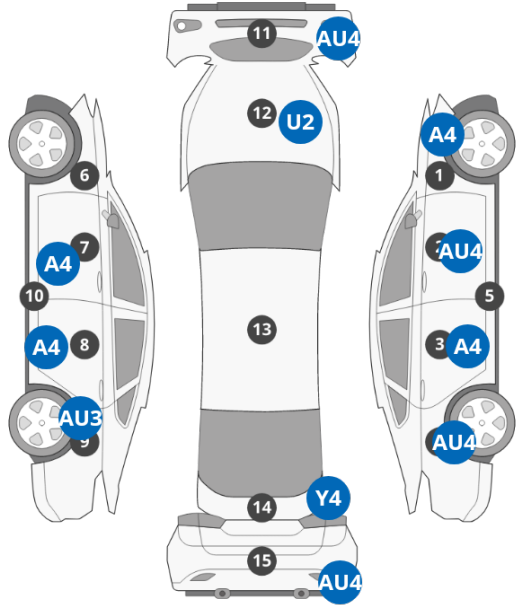
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	111	108	105
2	Boot Lid	108.0	101	105	118
3	Roof	93.2	99	91	91/91
4	Left Front Fender	95.5	102	98	87
5	Left Front Door	98.3	96	99	100
6	Center Panel Left				
7	Left Rear Door	362.6	803	134	151
8	Left Back Panel	316.6	139	150	661
9	Right Front Fender	91.0	95	89	90
10	Right Front Door	90.8	93	90	90
11	Center Panel Right				
12	Right Rear Door	92.4	91	96	90
13	Right Back Panel	93.4	87	94	99

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Small</p>	<p>Remarks (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Crack, Gap - Large / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>incomplete LTO plate/ no tools/ no jack/ with spare tire and warranty booklet/</p>