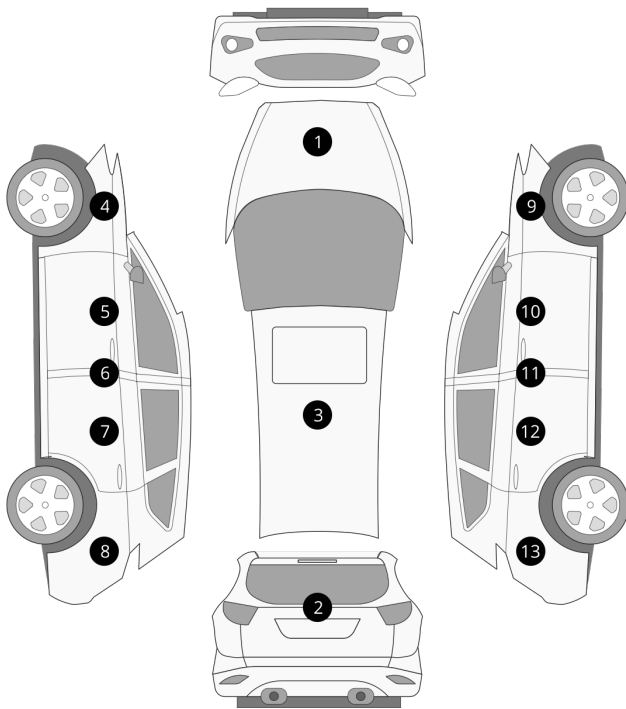


General Information

Date & Time: 26, Jan, 2026 13:18

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	40,912
Registration No.	NGC8692	Chassis No.	PA1B18F30R4261838
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



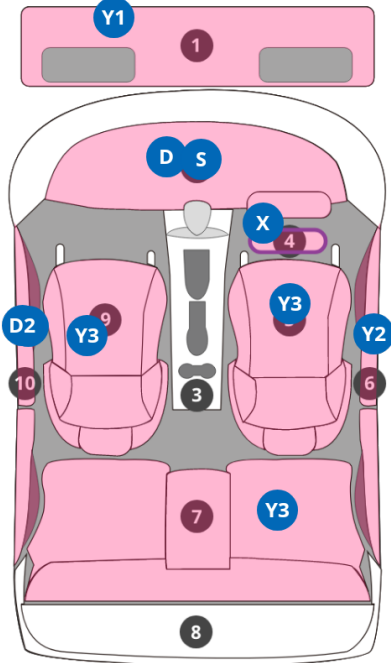
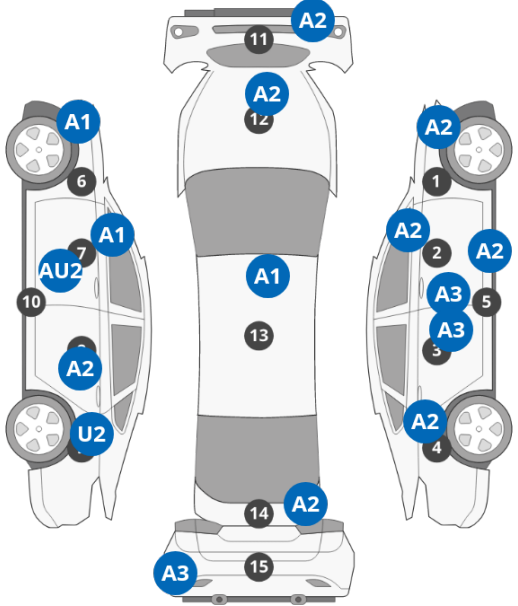
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	112	124	130
2	Boot Lid	122.6	128	114	126
3	Roof	114.2	121	113	111/112
4	Left Front Fender	106.0	109	105	104
5	Left Front Door	118.5	149	109	98
6	Center Panel Left				
7	Left Rear Door	102.6	102	100	106
8	Left Back Panel	227.6	162	216	305
9	Right Front Fender	111.3	106	117	111
10	Right Front Door	111.6	107	120	108
11	Center Panel Right				
12	Right Rear Door	118.6	116	102	138
13	Right Back Panel	109.0	107	104	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, jack and tools, with spare tire, with LTO plate, possible flooding, scratched and cracked tail light, brake light issue, power steering issue due to weak battery</p>