

General Information

Date & Time: 26, Jan, 2026 18:46

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	1,267
Registration No.	DBU5544	Chassis No.	PA1B18F38S4288386
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



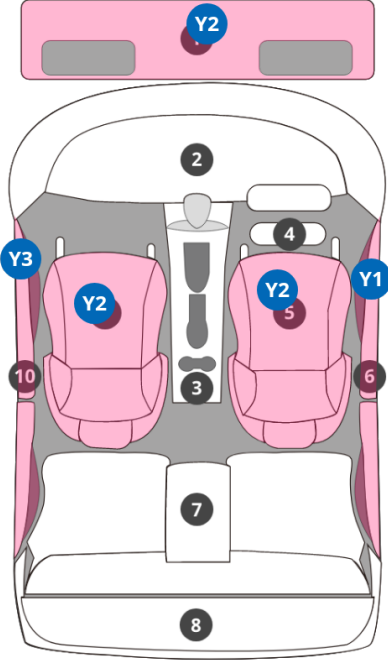
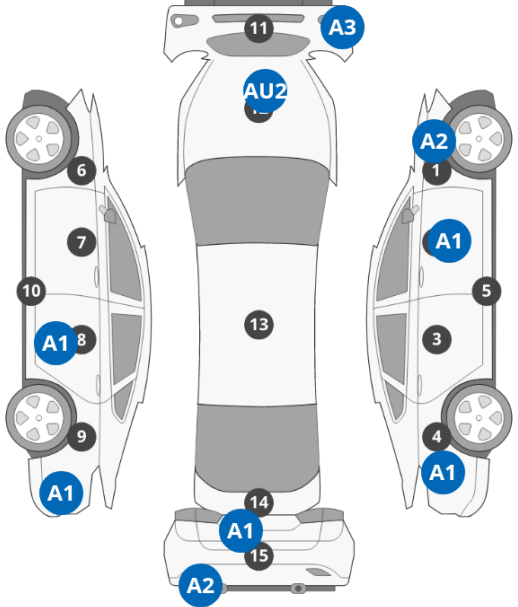
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	87.0	96	73	92
2	Boot Lid	90.7	94	86	93
3	Roof	88.0	94	91	78/89
4	Left Front Fender	128.0	142	121	121
5	Left Front Door	90.0	87	91	92
6	Center Panel Left				
7	Left Rear Door	92.4	97	89	91
8	Left Back Panel	97.5	111	90	92
9	Right Front Fender	90.0	93	87	90
10	Right Front Door	93.6	92	92	98
11	Center Panel Right				
12	Right Rear Door	95.5	96	94	98
13	Right Back Panel	94.5	91	93	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 3 key/No seat cover/with jack and incomplete tools/with reverse camera/with warranty booklet /cross member support traces of bending</p>