

General Information

Date & Time: 26, Jan, 2026 17:34

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	31,726
Registration No.	DBQ1895	Chassis No.	PA1B18F39R4268500
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



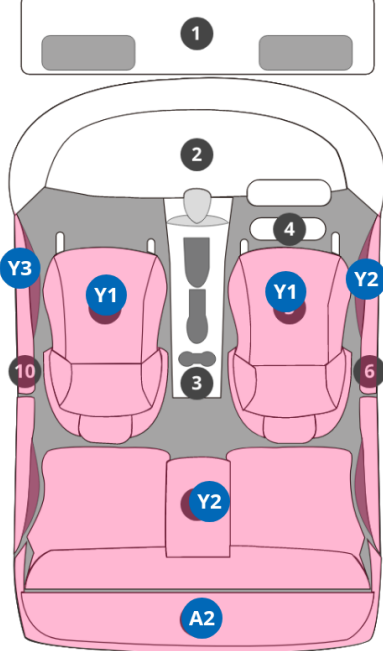
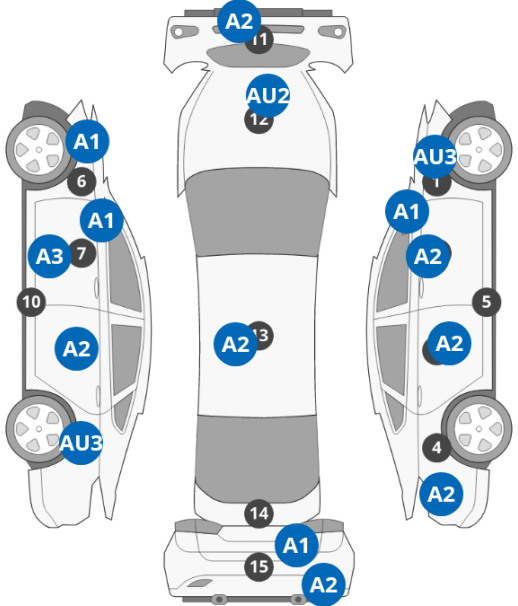
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.3	108	96	100
2	Boot Lid	97.9	95	99	100
3	Roof	93.8	104	95	89/87
4	Left Front Fender	90.4	93	90	88
5	Left Front Door	96.8	95	98	97
6	Center Panel Left				
7	Left Rear Door	102.9	112	102	95
8	Left Back Panel	98.8	104	100	92
9	Right Front Fender	97.4	98	94	100
10	Right Front Door	95.6	92	99	97
11	Center Panel Right				
12	Right Rear Door	96.3	100	96	94
13	Right Back Panel	93.9	90	94	98

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Minimal / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal</p>	<p>Remarks (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 3 key/with reverse/No warranty booklet/with jack and incomplete tools/with seat cover</p>