

General Information

Date & Time: 26, Jan, 2026 13:13

Make	Toyota	Model	Fortuner
YOM	2020	Odo Meter Reading	35,573
Registration No.	NFZ8243	Chassis No.	MHFJBGS1L1578504
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Brown		

Body / Panel Condition



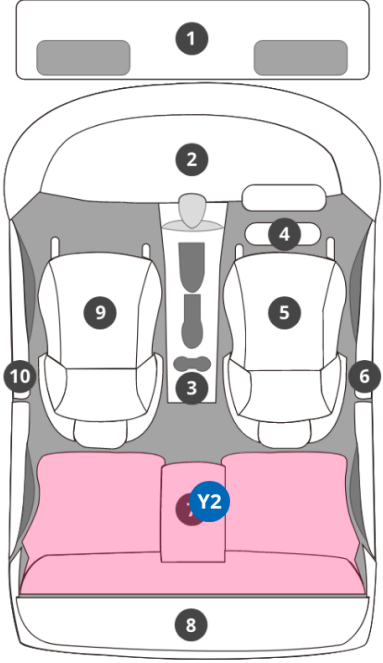
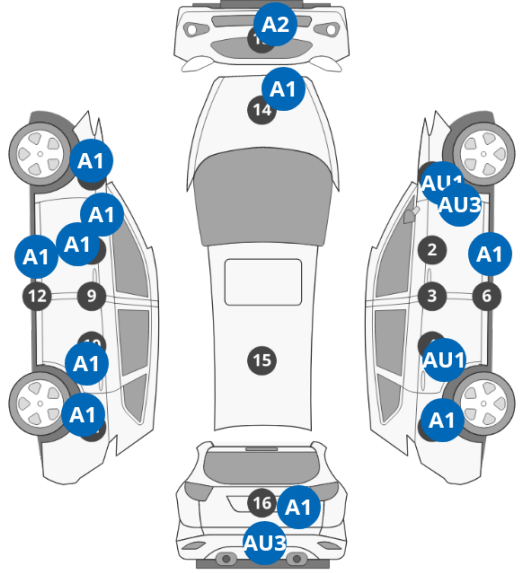
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	111	126	113
2	Boot Lid	107.9	94	127	103
3	Roof	105.9	118	118	94/94
4	Left Front Fender	114.6	119	117	108
5	Left Front Door	110.6	113	107	112
6	Center Panel Left				
7	Left Rear Door	99.4	111	93	94
8	Left Back Panel	113.0	115	110	114
9	Right Front Fender	112.9	130	111	98
10	Right Front Door	111.6	115	105	115
11	Center Panel Right				
12	Right Rear Door	105.6	101	104	112
13	Right Back Panel	109.0	114	103	110

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Rear Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights