

General Information

Date & Time: 23, Jan, 2026 17:19

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	6,648
Registration No.	BAG7247	Chassis No.	PA2JA8EM7R0149126
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



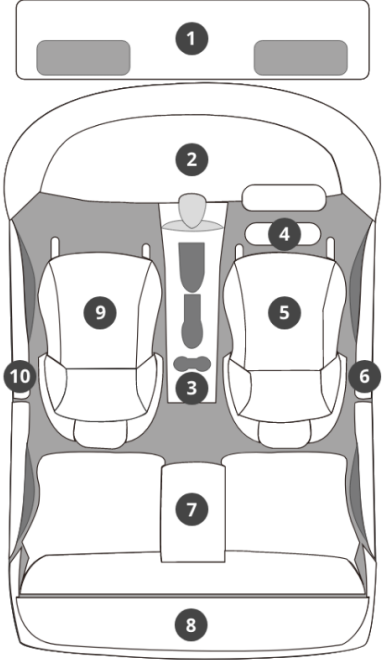
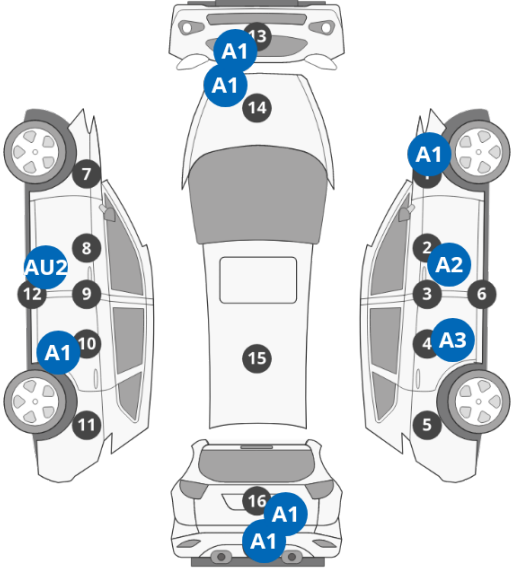
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.1	109	107	96
2	Boot Lid	108.6	113	109	104
3	Roof	88.2	90	88	88/87
4	Left Front Fender	94.8	89	103	93
5	Left Front Door	95.7	93	95	100
6	Center Panel Left				
7	Left Rear Door	101.6	109	100	96
8	Left Back Panel	107.6	114	107	102
9	Right Front Fender	94.5	92	102	90
10	Right Front Door	96.8	98	94	99
11	Center Panel Right				
12	Right Rear Door	96.2	89	96	104
13	Right Back Panel	105.6	101	112	104

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet, with spare tire, 3keys, no jack and tools, scratches on headlights and taillights, front underhood cover missing