

General Information

Date & Time: 23, Jan, 2025 17:31

Make	Toyota	Model	Vios
YOM	2022	Mileage	108,703
Registration No.	NFL3582	Chassis No.	PA1B18F31N4170572
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



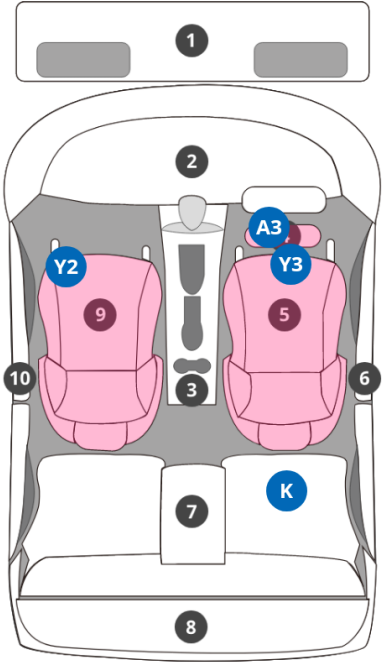
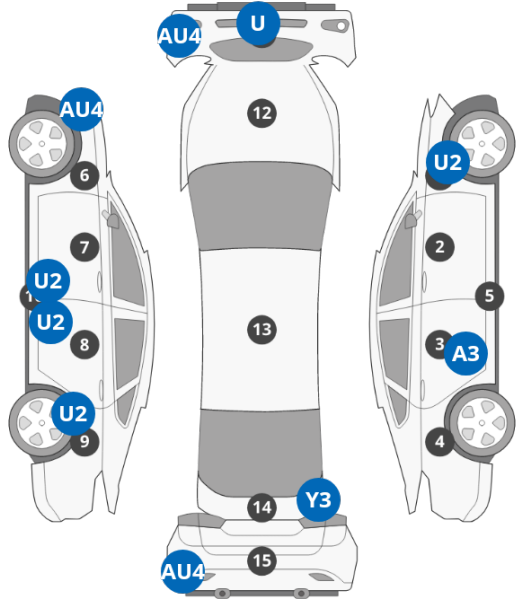
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	107	105	104
2	Boot Lid	99.1	100	100	98
3	Roof	97.0	101	90	92/105
4	Left Front Fender	101.5	103	98	104
5	Left Front Door	96.4	98	95	97
6	Center Panel Left				
7	Left Rear Door	95.2	100	95	91
8	Left Back Panel	101.4	103	98	103
9	Right Front Fender	95.9	94	95	99
10	Right Front Door	96.6	97	95	98
11	Center Panel Right				
12	Right Rear Door	98.8	94	102	100
13	Right Back Panel	100.0	105	94	101

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium	Remarks Trunk Hood, Rear Gate - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no plate light/ no warranty booklet/ with jack/ with spare tire/ with tools/ with LTO plate