

General Information

Date & Time: 26, Jan, 2026 10:59

Make	Toyota	Model	Rush
YOM	2024	Odo Meter Reading	26,472
Registration No.	CCA6399	Chassis No.	MHK8EFF2P081036
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



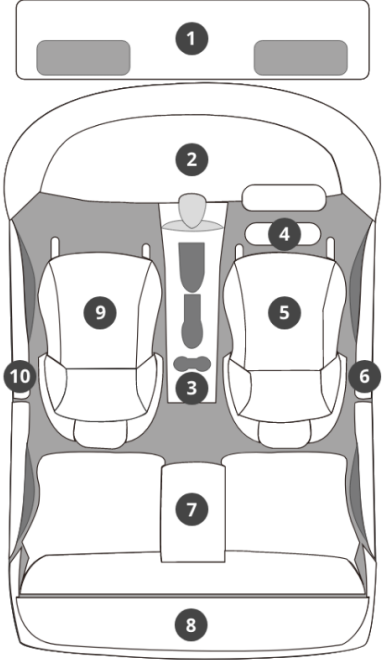
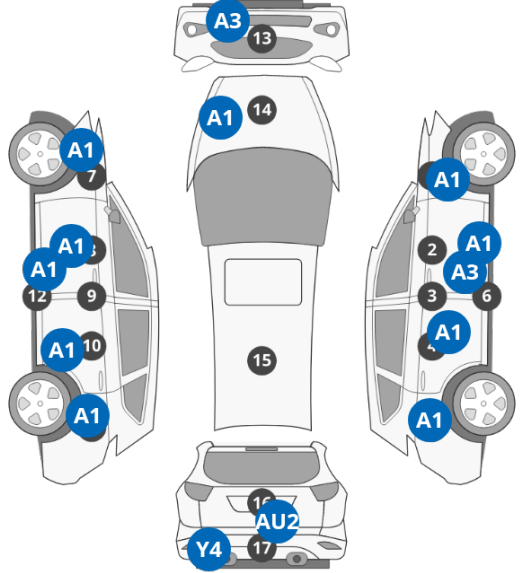
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.9	107	96	100
2	Boot Lid	89.8	85	91	94
3	Roof	93.6	86	90	100/99
4	Left Front Fender	95.9	99	96	93
5	Left Front Door	102.3	97	98	112
6	Center Panel Left				
7	Left Rear Door	101.0	110	94	99
8	Left Back Panel	92.3	101	92	84
9	Right Front Fender	100.8	105	101	97
10	Right Front Door	104.3	111	101	101
11	Center Panel Right				
12	Right Rear Door	101.9	104	96	106
13	Right Back Panel	97.9	101	93	100

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, 2keys, no tools, scratches on headlights