

General Information

Date & Time: 26, Jan, 2026 13:13

Make	Toyota	Model	Veloz
YOM	2024	Odo Meter Reading	36,392
Registration No.	NHS5563	Chassis No.	MHFAB1BY0R3096476
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



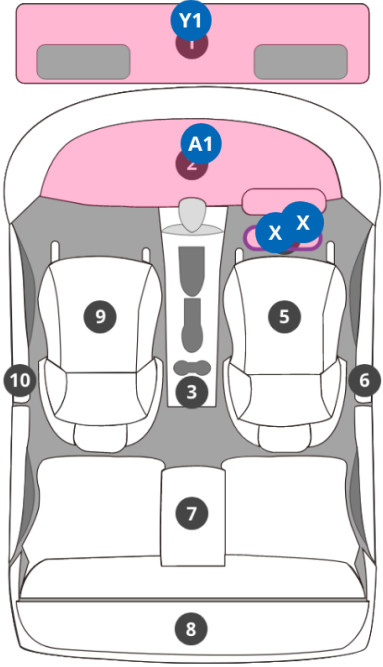
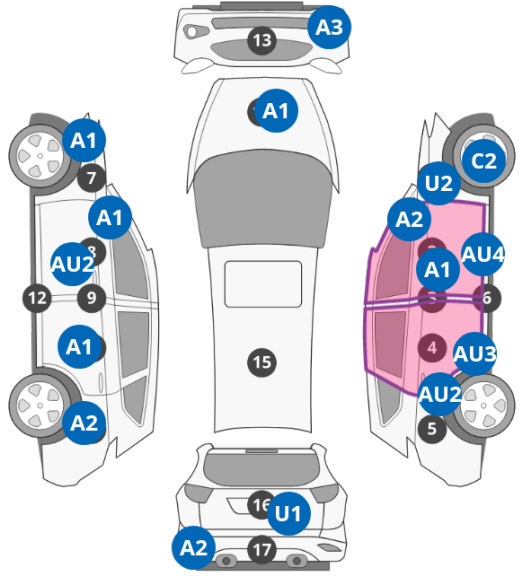
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.3	92	95	106
2	Boot Lid	96.5	83	108	98
3	Roof	109.1	119	120	99/99
4	Left Front Fender	95.2	96	95	95
5	Left Front Door	112.6	106	114	118
6	Center Panel Left				
7	Left Rear Door	108.1	111	97	116
8	Left Back Panel	114.6	121	114	109
9	Right Front Fender	94.9	94	97	94
10	Right Front Door	149.0	167	139	141
11	Center Panel Right				
12	Right Rear Door	318.6	167	355	434
13	Right Back Panel	119.3	119	110	129

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Worn, Scratch, Cut, Crack - Minimal / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (R) Front Wheel, Cover - Scratch, Corrosion - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, scratches on headlights and taillights, stain on hood and bumper</p>