

General Information

Date & Time: 22, Jan, 2025 14:56

Make	Toyota	Model	Vios
YOM	2021	Mileage	50,361
Registration No.	VAB1944	Chassis No.	PA1B18F31M4160946
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



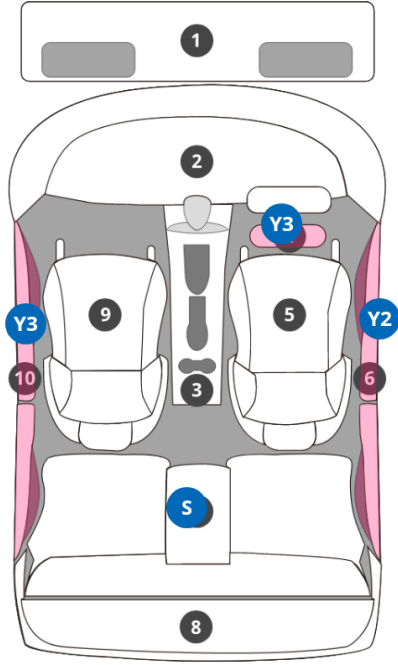
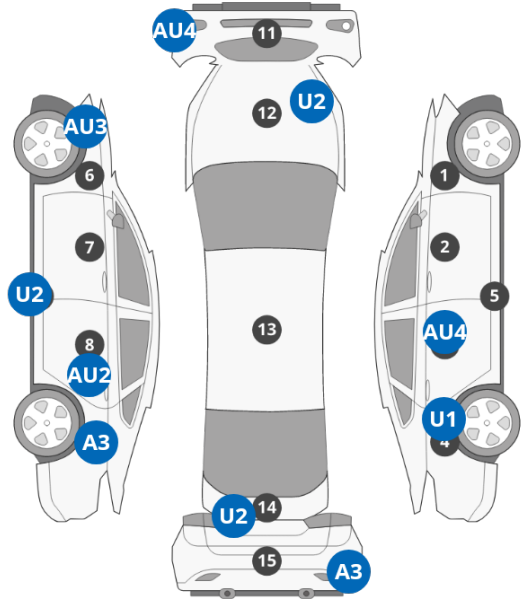
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	102	118	115
2	Boot Lid	101.0	100	99	104
3	Roof	101.8	96	86	98/127
4	Left Front Fender	87.0	86	86	89
5	Left Front Door	94.4	94	96	94
6	Center Panel Left				
7	Left Rear Door	91.8	97	92	87
8	Left Back Panel	103.3	109	101	100
9	Right Front Fender	90.2	94	90	88
10	Right Front Door	98.3	92	106	97
11	Center Panel Right				
12	Right Rear Door	99.2	104	98	95
13	Right Back Panel	97.4	90	99	103

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Overall Interior - Smell - Yes	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no tools/ no spare tire/ no LTO plate/ no warranty booklet/ with jack/ dirty trunk room