

General Information

Date & Time: 03, Feb, 2026 06:03

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	39,974
Registration No.	DBF7192	Chassis No.	PA1B18F30R4250709
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



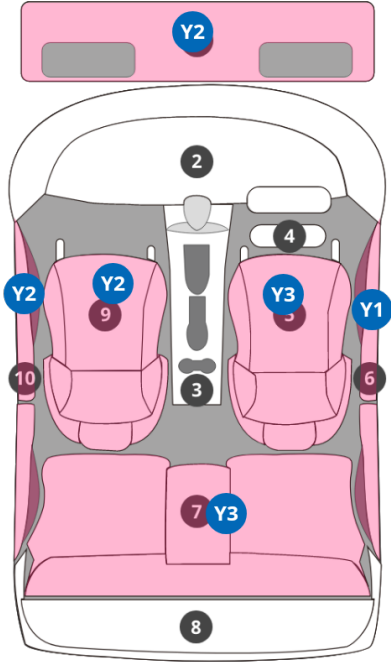
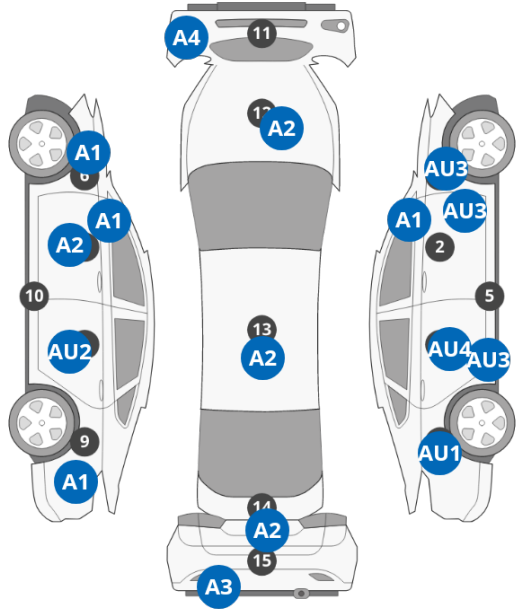
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.4	113	97	115
2	Boot Lid	98.5	99	100	96
3	Roof	93.2	95	99	85/94
4	Left Front Fender	92.8	94	90	95
5	Left Front Door	92.7	92	95	90
6	Center Panel Left				
7	Left Rear Door	98.7	101	101	94
8	Left Back Panel	101.8	108	99	99
9	Right Front Fender	95.3	101	94	92
10	Right Front Door	97.1	100	94	98
11	Center Panel Right				
12	Right Rear Door	100.6	98	101	103
13	Right Back Panel	99.3	96	96	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No jack and tools/with reverse camera/No warranty booklets/No seat cover/plate light issue/</p>