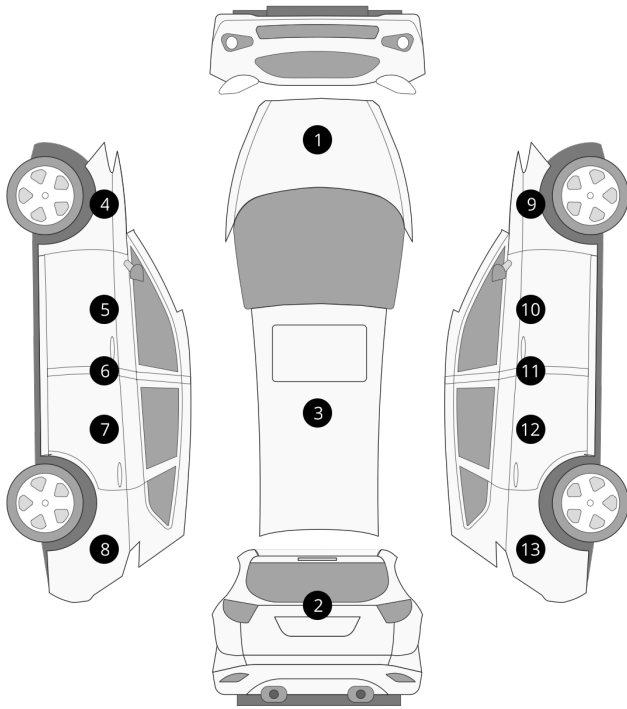


General Information

Date & Time: 27, Jan, 2026 15:45

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	49,201
Registration No.	DBN5341	Chassis No.	PA1B18F39P4229905
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



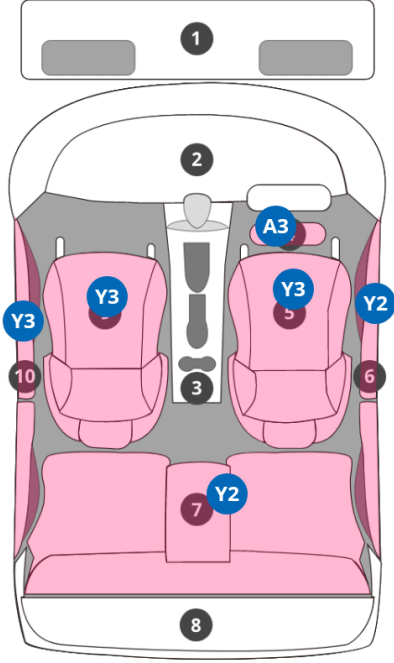
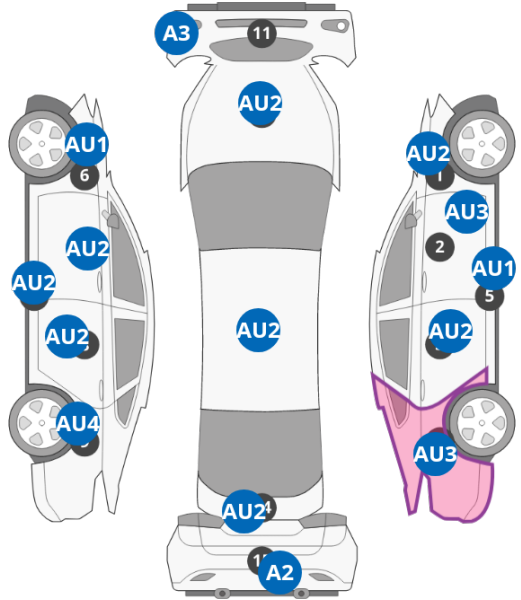
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.2	117	99	118
2	Boot Lid	114.0	116	103	123
3	Roof	97.6	101	91	105/94
4	Left Front Fender	97.7	96	97	100
5	Left Front Door	107.6	112	110	101
6	Center Panel Left				
7	Left Rear Door	109.0	113	105	109
8	Left Back Panel	112.3	124	112	101
9	Right Front Fender	105.4	110	91	115
10	Right Front Door	103.0	101	105	103
11	Center Panel Right				
12	Right Rear Door	151.6	166	145	144
13	Right Back Panel	164.3	160	155	178

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with tools & jack, no warranty and manual booklet, no reverse camera, scratches on taillight and headlight.</p>