

General Information

Date & Time: 02, Feb, 2026 15:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	12,176
Registration No.	DBO8259	Chassis No.	PA1B18F37R4257429
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



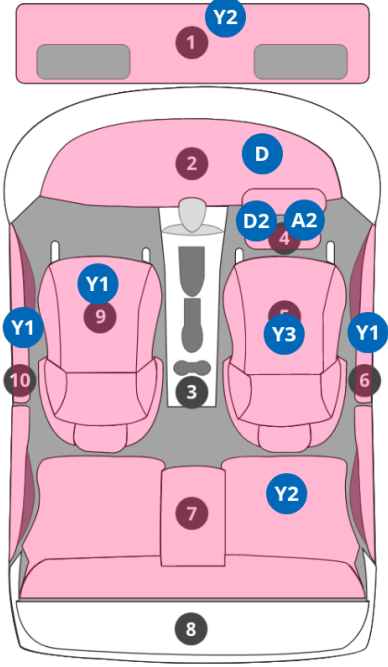
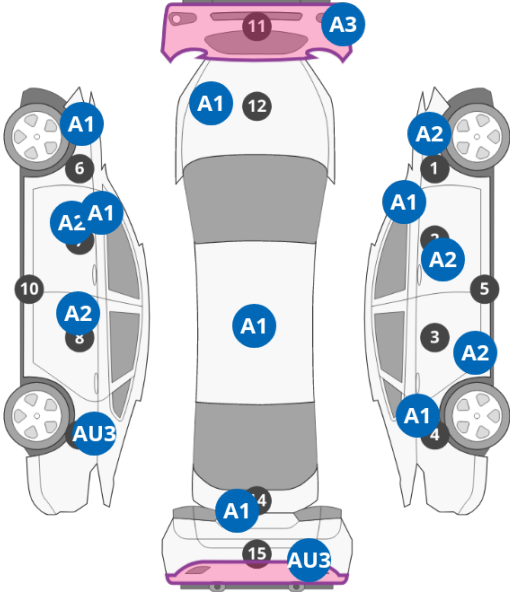
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.3	129	114	124
2	Boot Lid	259.0	248	261	268
3	Roof	118.7	121	131	105/118
4	Left Front Fender	103.3	104	104	102
5	Left Front Door	112.3	110	113	114
6	Center Panel Left				
7	Left Rear Door	128.0	126	121	137
8	Left Back Panel	120.0	123	114	123
9	Right Front Fender	117.0	111	123	117
10	Right Front Door	113.0	112	110	117
11	Center Panel Right				
12	Right Rear Door	116.3	110	113	126
13	Right Back Panel	123.0	124	113	132

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Small / (R) Front Floor Mat - Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, incomplete tools, no spare tire, with LTO plate, scratched and cracked tail light, head unit no display issue, audio/radio issue