

General Information

Date & Time: 27, Jan, 2026 09:58

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	18,190
Registration No.	DBQ8158	Chassis No.	PA1B18F39R4272451
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



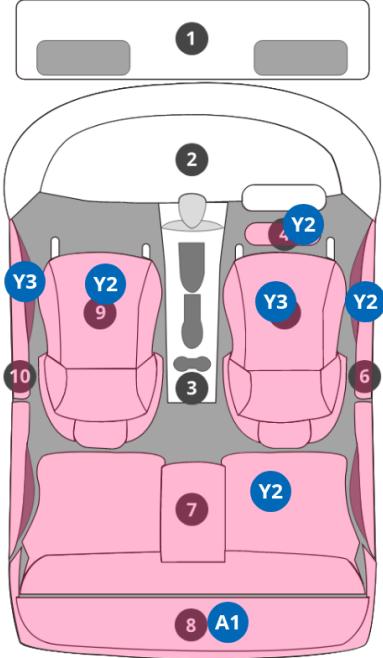
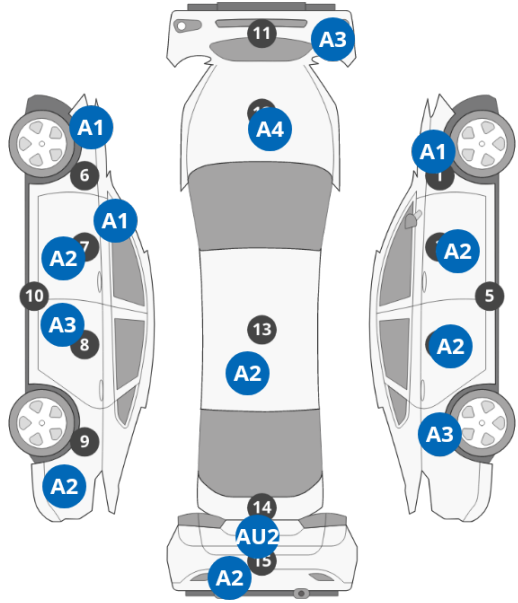
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.1	107	98	116
2	Boot Lid	99.6	98	99	102
3	Roof	97.4	103	96	97/94
4	Left Front Fender	94.8	97	92	96
5	Left Front Door	96.0	94	96	98
6	Center Panel Left				
7	Left Rear Door	104.3	113	100	100
8	Left Back Panel	107.0	117	100	104
9	Right Front Fender	100.8	102	101	100
10	Right Front Door	96.8	98	97	96
11	Center Panel Right				
12	Right Rear Door	97.8	95	97	102
13	Right Back Panel	96.0	90	93	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with reverse camera/with jack and incomplete tools/with warranty booklet/ No seat cover</p>