

General Information

Date & Time: 30, Jan, 2026 14:26

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	12,547
Registration No.	EAH5157	Chassis No.	PAHACACAXS6425883
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



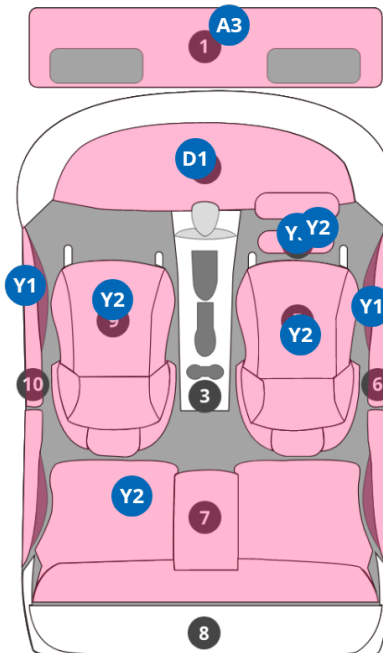
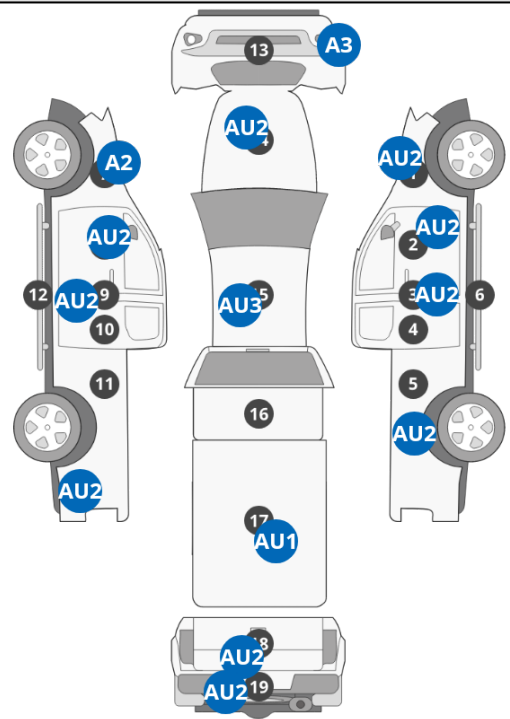
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.0	101	95	104
2	Boot Lid	67.1	75	62	65
3	Roof	130.2	132	136	121/132
4	Left Front Fender	103.3	104	106	100
5	Left Front Door	98.5	100	100	96
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	72.3	70	74	73
9	Right Front Fender	109.6	101	110	118
10	Right Front Door	98.6	93	98	105
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	78.6	78	80	78

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Dashboard - Worked - Minimal / Ceiling - Cut, Crack - Medium / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Medium / (R) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Small / (L) Center Panel - Scratch & Dent - Small / (R) Center Panel - Scratch & Dent - Small / Cargo Bed Floor - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with spare key, with warranty and manual booklet, scratches on taillight and headlight.</p>