

General Information

Date & Time: 03, Feb, 2026 08:28

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	13,335
Registration No.	NHN8217	Chassis No.	PA1B18F31R4254607
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



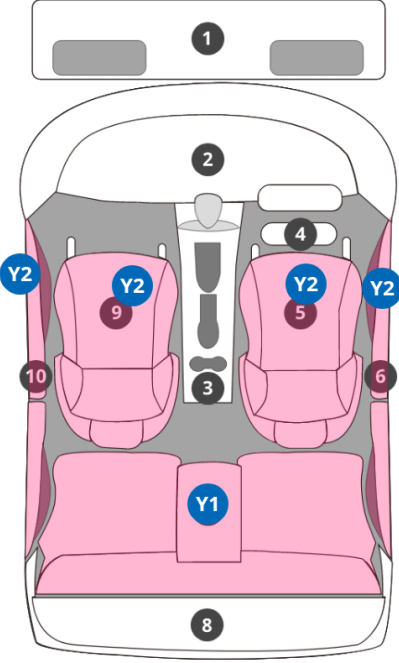
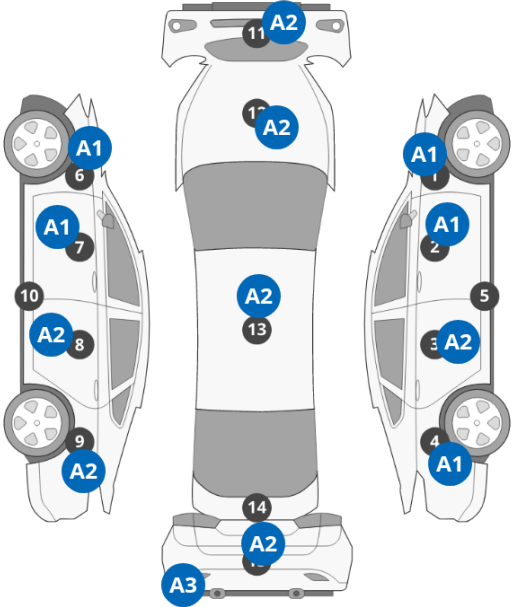
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	126	105	111
2	Boot Lid	110.0	100	115	115
3	Roof	98.5	107	92	101/94
4	Left Front Fender	123.0	131	120	118
5	Left Front Door	124.0	128	130	114
6	Center Panel Left				
7	Left Rear Door	107.0	115	105	101
8	Left Back Panel	110.3	119	106	106
9	Right Front Fender	103.6	106	103	102
10	Right Front Door	96.7	99	93	99
11	Center Panel Right				
12	Right Rear Door	102.2	100	95	112
13	Right Back Panel	105.6	100	98	119

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No seat cover/with jack and tools/No warranty booklets/with reverse camera/seatbelts issue</p>