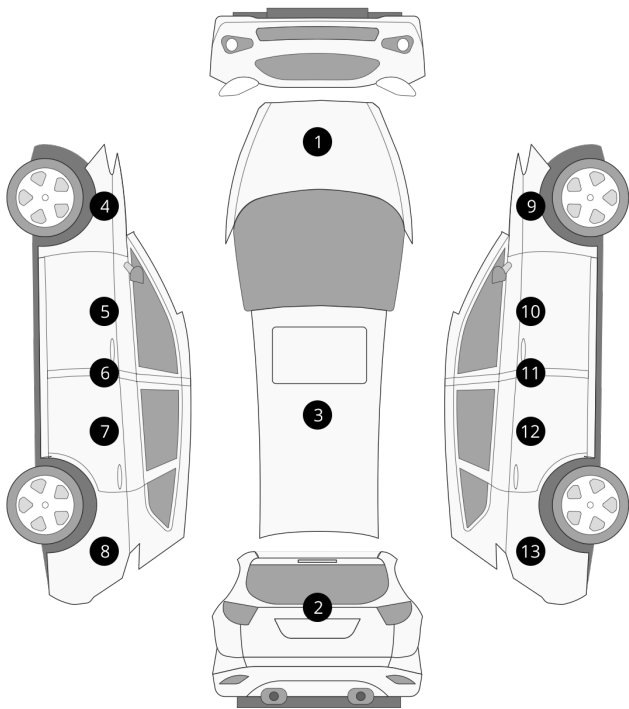


General Information

Date & Time: 06, Feb, 2026 15:37

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,652
Registration No.	NHU5297	Chassis No.	PA1B18F31R4273934
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



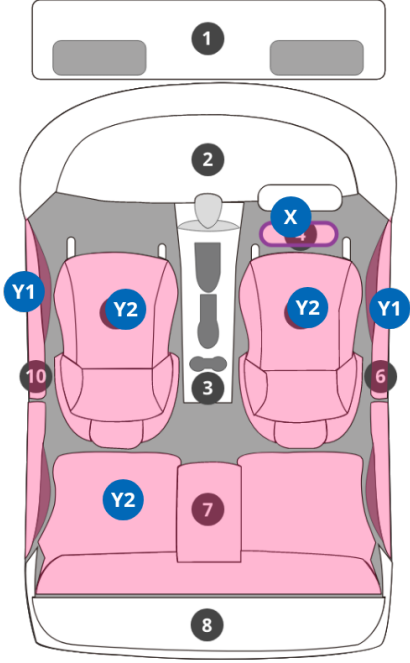
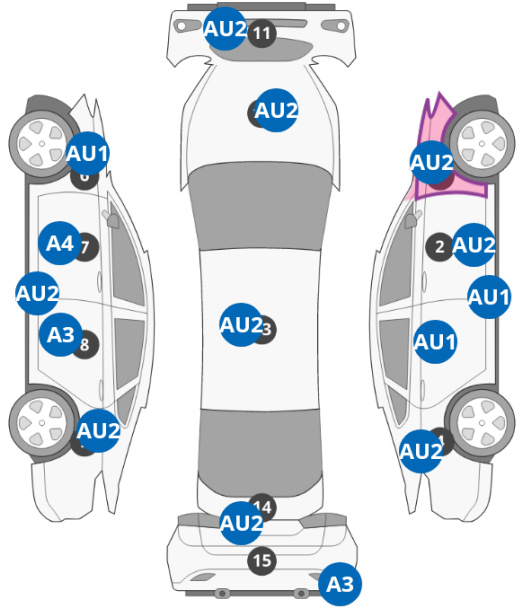
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.5	113	97	119
2	Boot Lid	118.6	112	111	133
3	Roof	102.5	106	97	106/101
4	Left Front Fender	106.6	102	104	114
5	Left Front Door	102.0	103	102	101
6	Center Panel Left				
7	Left Rear Door	105.3	113	101	102
8	Left Back Panel	114.6	127	114	103
9	Right Front Fender	326.0	229	301	448
10	Right Front Door	106.0	117	99	102
11	Center Panel Right				
12	Right Rear Door	109.8	109	99	122
13	Right Back Panel	105.0	99	102	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>	
<p>with LTO plate, with spare tire, with reverse camera, with manual and warranty booklet, no spare key, no tools and jack, scratches on taillight and headlight</p>	