

General Information

Date & Time: 10, Feb, 2026 08:37

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	19,441
Registration No.	DBJ7487	Chassis No.	PA2JA8EM2P0130822
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



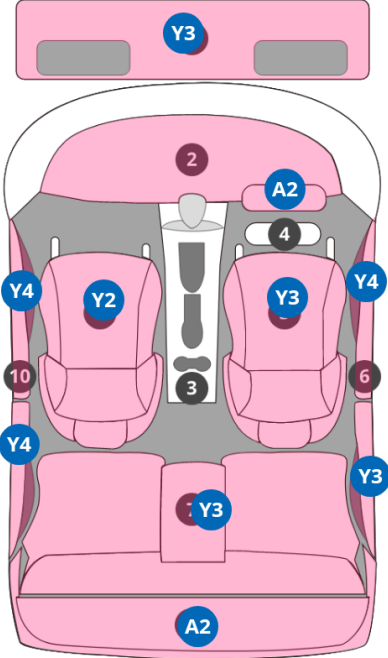
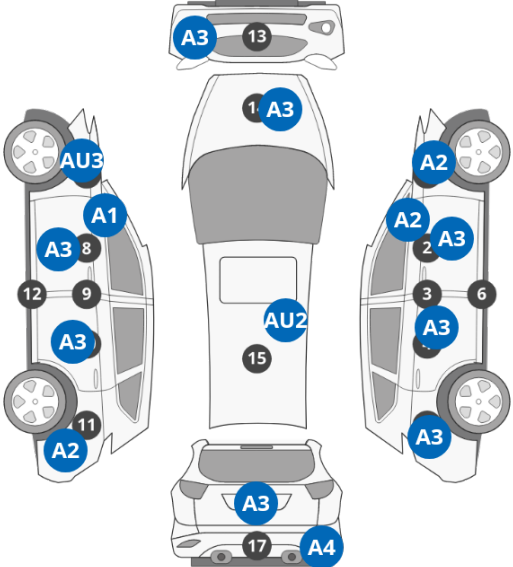
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.8	91	103	94
2	Boot Lid	90.0	88	91	91
3	Roof	105.8	85	88	99/152
4	Left Front Fender	91.7	93	92	91
5	Left Front Door	97.2	97	95	100
6	Center Panel Left				
7	Left Rear Door	98.6	106	93	97
8	Left Back Panel	100.2	100	101	100
9	Right Front Fender	91.8	92	98	85
10	Right Front Door	69.0	68	65	74
11	Center Panel Right				
12	Right Rear Door	75.6	65	69	94
13	Right Back Panel	141.3	135	142	147

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Large / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Medium</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 2 key/No seat cover/with jack and incomplete tools/No reverse camera/with warranty booklet</p>