

General Information

Date & Time: 10, Feb, 2026 10:43

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	20,132
Registration No.	DBO3645	Chassis No.	MHKU3FE10PK005800
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



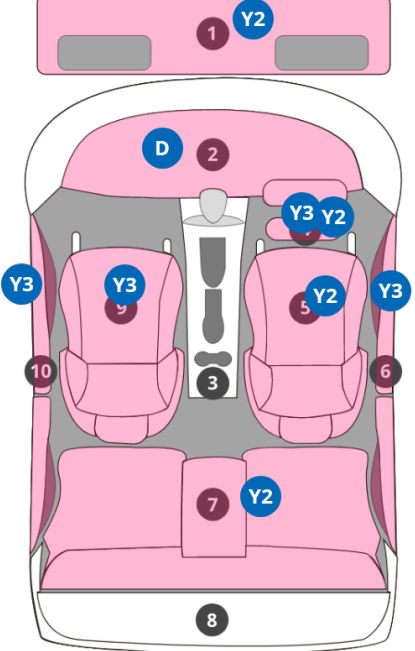
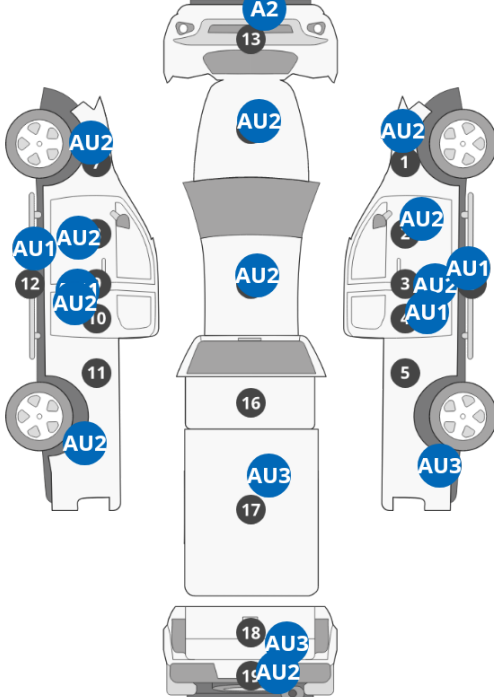
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	56.1	57	54	58
2	Boot Lid	69.5	90	57	61
3	Roof	53.1	48	57	50/58
4	Left Front Fender	56.7	53	57	60
5	Left Front Door	57.2	59	59	54
6	Center Panel Left	74.1	85	68	70
7	Left Rear Door				
8	Left Back Panel	84.8	84	100	71
9	Right Front Fender	68.1	74	65	66
10	Right Front Door	58.5	53	62	61
11	Center Panel Right	69.3	74	67	68
12	Right Rear Door				
13	Right Back Panel	60.8	64	61	58

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small</p>	<p>Remarks Cargo Bed Floor - Scratch & Dent - Medium / (L) Center Panel - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Panel - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Center Panel - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Rear Gate - Scratch & Dent - Medium / (R) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with manual booklet, no spare key, no tools, no jack, scratches on taillight and headlight,</p>