

General Information

Date & Time: 18, Feb, 2026 17:35

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	5,363
Registration No.	DBO5450	Chassis No.	PA1B18F3XR4238972
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



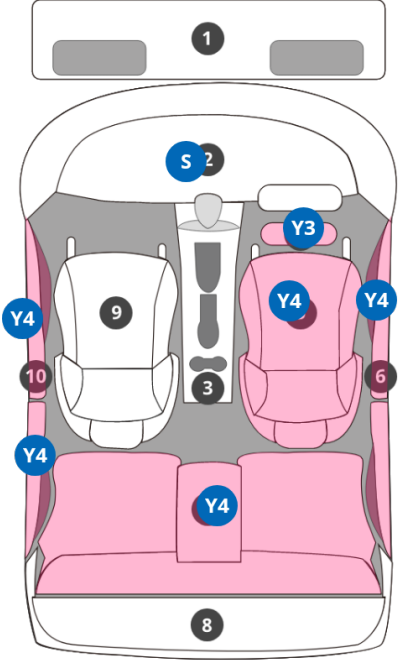
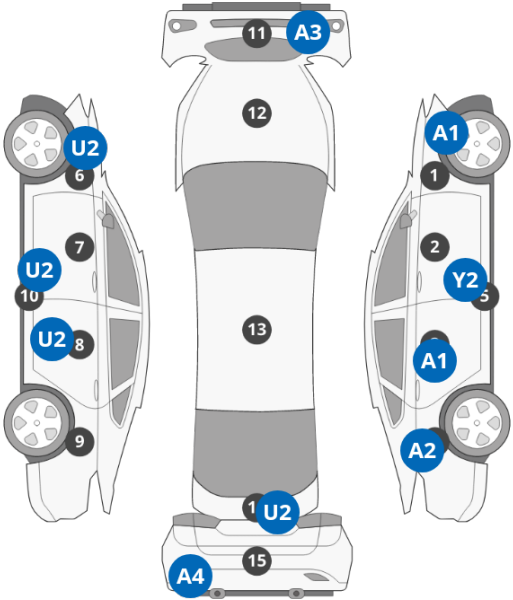
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	112	112	110
2	Boot Lid	103.3	100	104	106
3	Roof	102.7	108	101	96/106
4	Left Front Fender	95.2	97	89	99
5	Left Front Door	102.0	102	100	104
6	Center Panel Left				
7	Left Rear Door	107.6	112	110	101
8	Left Back Panel	106.0	102	109	107
9	Right Front Fender	103.0	108	100	101
10	Right Front Door	104.0	102	106	104
11	Center Panel Right				
12	Right Rear Door	109.3	103	108	117
13	Right Back Panel	112.0	115	107	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Large / (R) Front Floor Mat - Grime - Medium / (L) Rear Trim - Grime - Large / (L) Front Trim - Grime - Large</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Dent - Small / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Dent - Small / (R) Front Door, Molding - Crack, Gap - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>incomplete tools/ possible flooding/ with jack and spare tire/ with LTO plate/ with warranty booklet</p>