

General Information

Date & Time: 09, Feb, 2026 15:44

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,145
Registration No.	DBS4919	Chassis No.	PA1B18F30R4278252
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



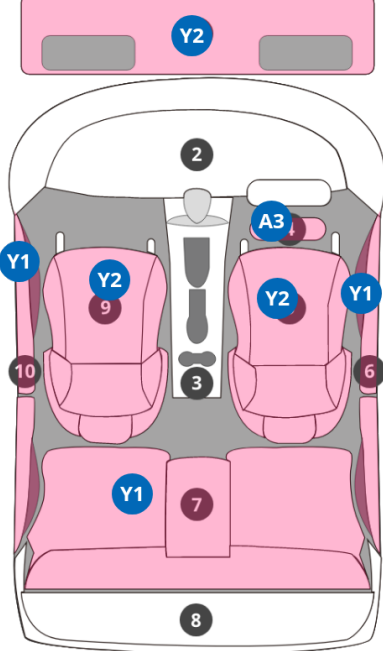
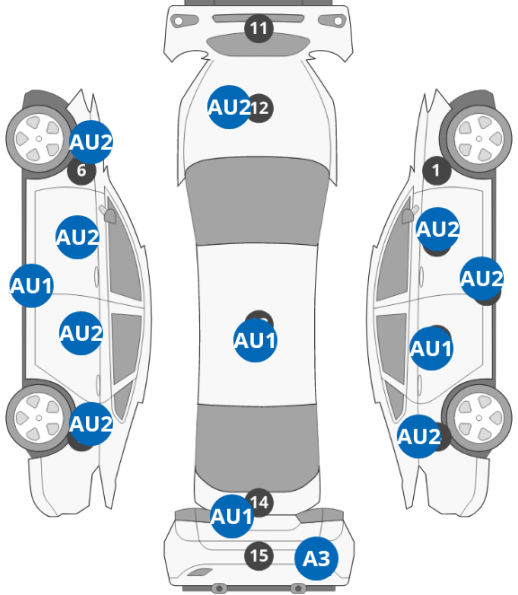
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	135	103	128
2	Boot Lid	120.0	118	108	134
3	Roof	115.7	113	103	105/142
4	Left Front Fender	109.6	113	109	107
5	Left Front Door	112.6	105	119	114
6	Center Panel Left				
7	Left Rear Door	113.6	106	122	113
8	Left Back Panel	123.3	137	124	109
9	Right Front Fender	111.3	117	106	111
10	Right Front Door	112.0	112	113	111
11	Center Panel Right				
12	Right Rear Door	122.3	110	112	145
13	Right Back Panel	114.0	110	119	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with reverse camera, with manual and warranty booklet, no spare key, no tools, scratches on taillight and headlight.</p>