

General Information

Date & Time: 10, Feb, 2026 09:56

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	5,960
Registration No.	DBT7390	Chassis No.	PA1B18F31S4285698
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



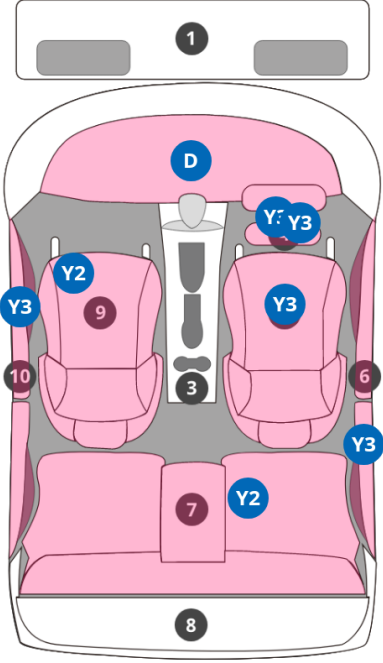
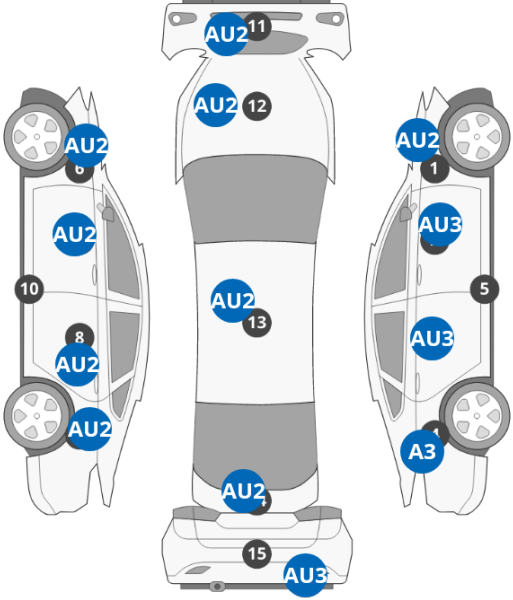
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.3	129	107	131
2	Boot Lid	118.6	122	103	131
3	Roof	110.7	118	103	107/115
4	Left Front Fender	104.3	104	101	108
5	Left Front Door	100.1	103	98	100
6	Center Panel Left				
7	Left Rear Door	108.6	120	105	101
8	Left Back Panel	111.3	117	108	109
9	Right Front Fender	102.3	104	101	102
10	Right Front Door	104.3	113	100	100
11	Center Panel Right				
12	Right Rear Door	105.6	99	102	116
13	Right Back Panel	99.7	91	100	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with manual booklet, with reverse camera, no spare key, scratches on taillight and headlight</p>