

General Information

Date & Time: 10, Feb, 2026 13:58

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	11,977
Registration No.	NFR1836	Chassis No.	PA2JA8EMXR0139349
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



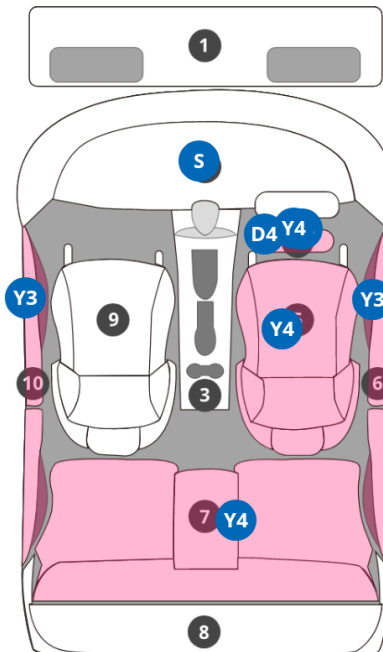
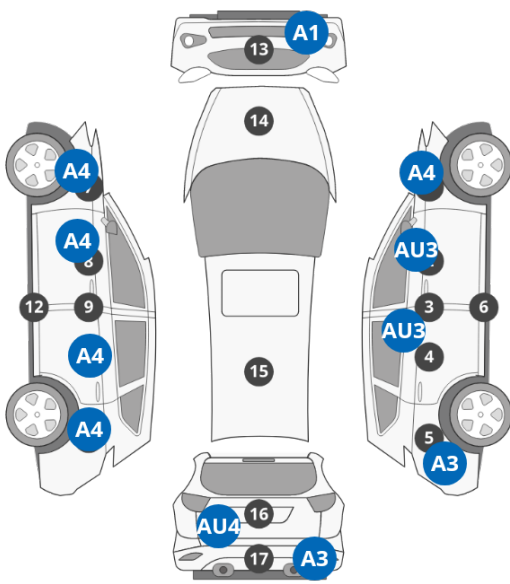
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.0	130	123	116
2	Boot Lid	101.5	107	101	97
3	Roof	101.4	100	101	95/110
4	Left Front Fender	104.2	111	108	94
5	Left Front Door	100.6	100	100	102
6	Center Panel Left				
7	Left Rear Door	101.8	108	104	94
8	Left Back Panel	101.2	99	105	100
9	Right Front Fender	102.4	96	101	110
10	Right Front Door	102.0	103	100	103
11	Center Panel Right				
12	Right Rear Door	99.2	91	98	109
13	Right Back Panel	107.0	120	104	97

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Large / (L) Front Floor Mat - Worked - Large / Overall Interior - Smell - Yes</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ possible flooding/ with tools and jack/ with LTO plate/</p>